

AD-A106 760

NEW YORK STATE DEPT OF ENVIRONMENTAL CONSERVATION ALBANY F/6 13/13
NATIONAL DAM SAFETY PROGRAM. COLD SPRING DAM (LOWER) (INVENTORY--ETC(U)
AUG 81 @ KOCH

DACW51-79-C-0001

NL

UNCLASSIFIED

3-1
200700

END

DATE

FILED

11-81

DTIC

LEVEL II

8

LOWER HUDSON RIVER BASIN

COLD SPRING DAM (LOWER)

PUTNAM COUNTY, NEW YORK

INVENTORY NO. N.Y. 107

**PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM**

AD A106760



**APPROVED FOR PUBLIC RELEASE;
DISTRIBUTION UNLIMITED**

DTIC FILE COPY

NEW YORK DISTRICT CORPS OF ENGINEERS

JUNE, 1981

**DTIC
ELECTE**

OCT 30 1981

D

X
35

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
	AD-A106760	
4. TITLE (and Subtitle) Phase I Inspection Report Cold Spring Dam (Lower) Lower Hudson River Basin, Putnam County, N.Y. Inventory No. 107		5. TYPE OF REPORT & PERIOD COVERED Phase I Inspection Report National Dam Safety Program
7. AUTHOR(s) 10 GEORGE KOCH		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS New York State Department of Environmental Conservation 50 Wolf Road Albany, New York 12233		8. CONTRACT OR GRANT NUMBER(s) DACW51-79-C-0001
11. CONTROLLING OFFICE NAME AND ADDRESS Department of the Army 26 Federal Plaza New York District, CofE New York, New York 10287		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 11
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) Department of the Army 26 Federal Plaza New York District, CofE New York, NY 10287		12. REPORT DATE 26 August 1981
15. SECURITY CLASS. (of this report) UNCLASSIFIED		13. NUMBER OF PAGES
15a. DECLASSIFICATION/DOWNGRADING SCHEDULE		
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; Distribution unlimited.		
17. 1 National Dam Safety Program. Cold Spring Dam (Lower) (Inventory Number NY 107), Lower Hudson River Basin, Putnam County, New York. Phase I Inspection Report. 12 84		
18. SUPPLEMENTARY NOTES		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Dam Safety National Dam Safety Program Visual Inspection Hydrology, Structural Stability Cold Spring Dam (Lower) Putnam County Lower Hudson River Basin		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) This report provides information and analysis on the physical condition of the dam as of the report date. Information and analysis are based on visual inspection of the dam by the performing organization. Visual inspection of this dam did not reveal conditions which constitute an immediate hazard to human life or property. However, the dam has some deficiencies which require further engineering investigations. ←		

Structural stability analyses performed for this report indicate that the factors of safety are below recommended values for all conditions studied. In addition, there was a wet area noted at the downstream toe of the dam which extended for about 100 feet from the edge of the spillway channel toward the left end of the dam.

It is recommended that within 3 months of the date of notification of the owner, further investigations of the structural stability of the dam and of the wet area at the downstream toe should be commenced. These studies should include subsurface explorations to obtain information about the dam's foundation and about uplift forces. This data should then be incorporated into a detailed stability evaluation. Necessary remedial measures to correct both the stability deficiencies and the wet area should be completed within 18 months.

The hydrologic/hydraulic analysis performed indicates that the dam will be overtopped by all storms exceeding 31% of the Probable Maximum Flood (PMF). Stability analyses performed for this structure indicate that when the dam is subjected to the flow resulting from one-half the PMF, the factors of safety are below recommended values. Since the dam is only marginally stable under this loading condition, the spillway capacity has been rated as inadequate.

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A	

DTIC
ELECTE
S **D**
 OCT 30 1981
D

PREFACE

This report is prepared under guidance contained in the Recommended Guidelines for Safety Inspection of Dams, for Phase I Investigations. Copies of these guidelines may be obtained from the Office of Chief of Engineers, Washington, D.C. 20314. The purpose of a Phase I Investigation is to identify expeditiously those dams which may pose hazards to human life or property. The assessment of the general condition of the dam is based upon available data and visual inspections. Detailed investigation, and analyses involving topographic mapping, subsurface investigations, testing, and detailed computational evaluations are beyond the scope of a Phase I Investigation; however, the investigation is intended to identify any need for such studies.

In reviewing this report, it should be realized that the reported condition of the dam is based on observations of field conditions at the time of inspection along with data available to the inspection team. In cases where the reservoir was lowered or drained prior to inspection, such action, while improving the stability and safety of the dam, removes the normal load on the structure and may obscure certain conditions which might otherwise be detectable if inspected under the normal operating environment of the structure.

It is important to note that the condition of a dam depends on numerous and constantly changing internal and external conditions, and is evolutionary in nature. It would be incorrect to assume that the present condition of the dam will continue to represent the condition of the dam at some point in the future. Only through frequent inspections can unsafe conditions be detected and only through continued care and maintenance can these conditions be prevented or corrected.

Phase I inspections are not intended to provide detailed hydrologic and hydraulic analyses. In accordance with the established Guidelines, the Spillway Test flood is based on the estimated "Probable Maximum Flood" for the region (greatest reasonably possible storm runoff), or fractions thereof. Because of the magnitude and rarity of such a storm event, a finding that a spillway will not pass the test flood should not be interpreted as necessarily posing a highly inadequate condition. The test flood provides a measure of relative spillway capacity and serves as an aide in determining the need for more detailed hydrologic and hydraulic studies, considering the size of the dam, its general condition and the downstream damage potential.

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
COLD SPRING DAM (LOWER)
I.D.NO. N.Y. 107
LOWER HUDSON RIVER BASIN
PUTNAM.COUNTY, NEW YORK

TABLE OF CONTENTS

	<u>PAGE NO.</u>
- ASSESSMENT	-
- OVERVIEW PHOTOGRAPH	-
1 PROJECT INFORMATION	1
1.1 GENERAL	1
1.2 DESCRIPTION OF PROJECT	1
1.3 PERTINENT DATA	2
2 ENGINEERING DATA	4
2.1 GEOTECHNICAL DATA	4
2.2 DESIGN RECORDS	4
2.3 CONSTRUCTION RECORDS	4
2.4 OPERATION RECORDS	5
2.5 EVALUATION OF DATA	5
3 VISUAL INSPECTION	6
3.1 FINDINGS	6
3.2 EVALUATION OF OBSERVATIONS	7
4 OPERATION AND MAINTENANCE PROCEDURES	8
4.1 PROCEDURE	8
4.2 MAINTENANCE OF DAM	8
4.3 WARNING SYSTEM IN EFFECT	8
4.4 EVALUATION	8

	<u>PAGE NO.</u>
5 HYDROLOGIC/HYDRAULIC	9
5.1 DRAINAGE AREA CHARACTERISTICS	9
5.2 ANALYSIS CRITERIA	9
5.3 SPILLWAY CAPACITY	9
5.4 RESERVOIR CAPACITY	9
5.5 FLOODS OF RECORD	10
5.6 OVERTOPPING POTENTIAL	10
5.7 EVALUATION	10
6 STRUCTURAL STABILITY	11
6.1 EVALUATION OF STRUCTURAL STABILITY	11
7 ASSESSMENT/RECOMMENDATIONS	13
7.1 ASSESSMENT	13
7.2 RECOMMENDED MEASURES	14

APPENDIX

- A. PHOTOGRAPHS
- B. VISUAL INSPECTION CHECKLIST
- C. HYDROLOGIC/HYDRAULIC ENGINEERING DATA AND COMPUTATIONS
- D. STRUCTURAL STABILITY ANALYSES
- E. REFERENCES
- F. DRAWINGS

**PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM**

Name of Dam:	Cold Spring Dam (Lower) (I.D. No. NY-107)
State Located:..	New York
County:	Putnam
Watershed:	Lower Hudson River Basin
Stream:	Foundry Brook
Date of Inspection:	April 22, 1981

ASSESSMENT:

Visual inspection of this dam did not reveal conditions which constitute an immediate hazard to human life or property. However, the dam has some deficiencies which require further engineering investigations.

Structural stability analyses performed for this report indicate that the factors of safety are below recommended values for all conditions studied. In addition, there was a wet area noted at the downstream toe of the dam which extended for about 100 feet from the edge of the spillway channel toward the left end of the dam.

It is recommended that within 3 months of the date of notification of the owner, further investigations of the structural stability of the dam and of the wet area at the downstream toe should be commenced. These studies should include subsurface explorations to obtain information about the dam's foundation and about uplift forces. This data should then be incorporated into a detailed stability evaluation. Necessary remedial measures to correct both the stability deficiencies and the wet area should be completed within 18 months.

The hydrologic/hydraulic analysis performed indicates that the dam will be overtopped by all storms exceeding 31% of the Probable Maximum Flood (PMF). Stability analyses performed for this structure indicate that when the dam is subjected to the flow resulting from one-half the PMF, the factors of safety are below recommended values. Since the dam is only marginally stable under this loading condition, the spillway capacity has been rated as inadequate.

Several other deficiencies were noted on this structure. These deficiencies should be corrected within 12 months of the date of notification of the owner. Among the required actions are the following:

1. Large trees growing along the downstream toe of the dam should be cut.

2. Deteriorated concrete and cracks on the crest should be repaired.

3. An emergency action plan for the notification of downstream residents should be developed and implemented.

George Koch *rw*


George Koch
Chief, Dam Safety Section
New York State Department
of Environmental Conservation
NY License No. 45937

Approved By:

W.M. Smith Jr.
Col. W.M. Smith Jr.
New York District Engineer

Date:

26 Aug 81

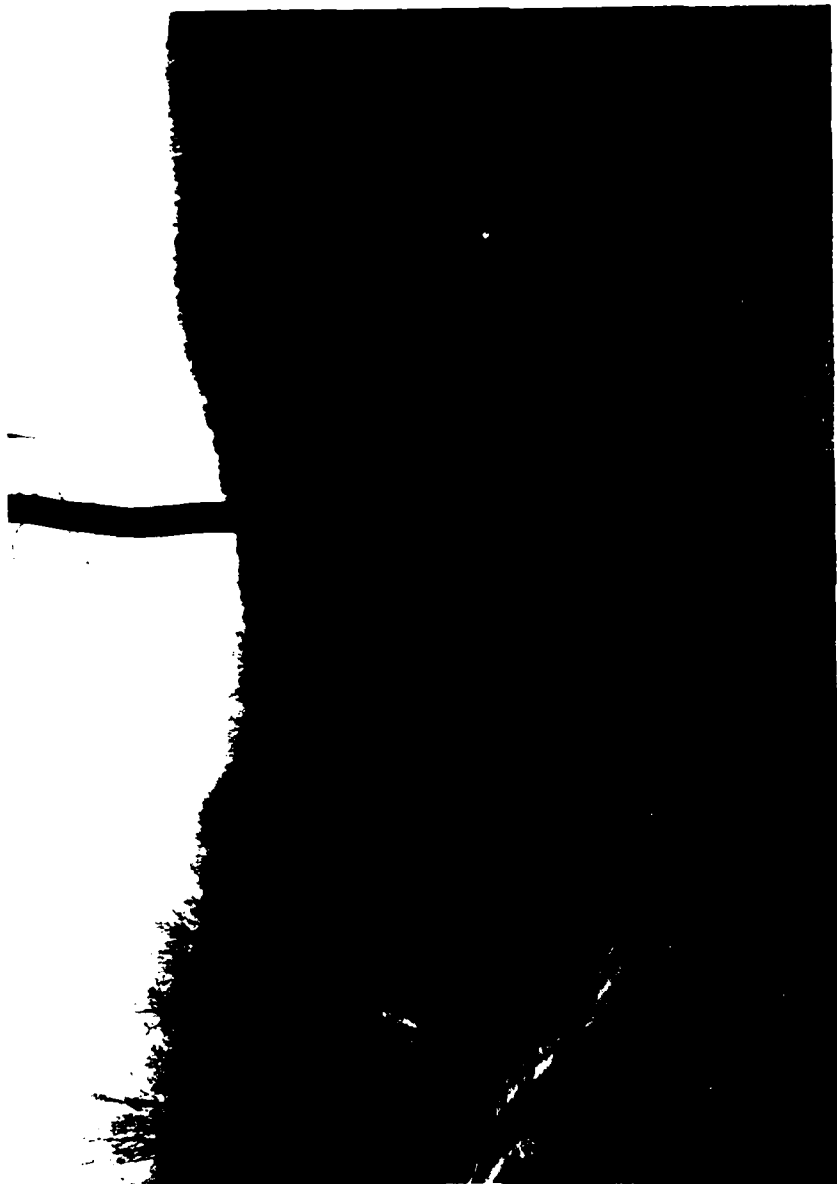

OVERVIEW (LOWER)
COLD SPRING DAM
I.D. NO. NY-107

PHASE I INSPECTION REPORT
NATIONAL DAM SAFETY PROGRAM
COLD SPRING DAM (LOWER)
I.D. NO. NY 107
#213-1004L LOWER HUDSON RIVER BASIN
PUTNAM COUNTY, NEW YORK

SECTION 1: PROJECT INFORMATION

1.1 GENERAL

a. Authority

The Phase I inspection reported herein was authorized by the Department of the Army, New York District, Corps of Engineers, to fulfill the requirements of the National Dam Inspection Act, Public Law 92-367.

b. Purpose of Inspection

This inspection was conducted to evaluate the existing conditions of the dam, to identify deficiencies and hazardous conditions, to determine if these deficiencies constitute hazards to life and property and to recommend remedial measures where required.

1.2 DESCRIPTION OF PROJECT

a. Description of Dam

Cold Spring Dam (Lower) is a laid up stone and concrete dam with an overflow spillway located near the right end of the dam. The dam is 330 feet long and about 20 feet high. The crest width of the dam is 15 feet.

The spillway consists of three openings each approximately 10 feet wide and 2.5 feet high. Openings are separated by concrete piers, each of which are 1.5 feet wide. These piers support a 5 inch thick concrete foot bridge across the top of the spillway.

The dam has a 12 inch diameter low level outlet pipe passing through a rectangular opening at the base of the spillway section. The valve for this pipe is located in a concrete manhole in the reservoir. A short concrete bridge provides access between the dam crest and this manhole. This pipe is used to discharge water from the reservoir when it is required by the water supply system.

b. Location

This dam is located off Lake Surprise Road in the Town of Philips-town. It is approximately one mile west of New York State Route 9 and about 3 miles north of the Village of Cold Spring. The Cold Spring Upper Reservoir is located immediately upstream of this reservoir.

c. Size Classification

This dam is 20 feet high and has a storage capacity of approximately 70 acre-feet. Therefore, the dam is in the small size category as defined by the "Recommended Guidelines for the Safety Inspection of Dams."

d. Hazard Classification

This dam is classified as "high" hazard due to the presence of two homes immediately downstream of the dam and several other residences located adjacent to the stream channel approximately 1 mile downstream of the dam.

e. Ownership

This dam is owned by the Village of Cold Spring whose mayor is Mr. Ronald A. McConville. His address is Cold Spring, New York 10516. His office telephone number is (914) 265-3611.

f. Purpose of Dam

This dam was originally constructed to impound water for the West Point Foundry. It was purchased by the Village of Cold Spring in about 1925 to provide an additional water supply. It continues to be used for this purpose.

g. Design and Construction History

This dam was reportedly constructed in about 1840. It was reconstructed in 1939. Mr. Allan Smith, Professional Engineer of Cold Spring, designed the modifications.

h. Normal Operating Procedures

There are no prescribed operating procedures for this structure. Water, when it is required by the water supply system, is discharged into Foundry Brook.

1.3 PERTINENT DATA

<u>a. Drainage Area (acres)</u>	496
<u>b. Discharge at Dam (cfs)</u>	
Spillway with Water Surface at Top of Dam	365
Low level outlet with water surface at spillway crest	13
<u>c. Elevation (USGS Datum)</u>	
Top of Dam	628.5
Spillway Crest	626.0

d. Reservoir - Surface Area (acres)

Top of Dam	12
Spillway Crest	9

e. Storage Capacity (acre-feet)

Top of Dam	70
Spillway Crest	54

f. Dam

Type: Laid up stone dam covered with concrete on crest and upstream face

Dam Length (ft)	330
Crest Width (ft)	15
Dam Height (ft)	20

g. Spillway

Type: Uncontrolled broad crested weir; divided into three sections which are separated by bridge piers, each section approximately 10 feet wide by 2.5 feet high.

Weir Length (ft)	31.25
------------------	-------

h. Low Level Outlet

Type: 12 inch diameter pipe through rectangular opening in dam which outlets at downstream toe; concrete manhole at upstream face contains valve controlling flow through pipe; valve stem extends to top of manhole; access via bridge from dam crest.

Control: Valve is reportedly operational.

SECTION 2: ENGINEERING DATA

2.1 GEOTECHNICAL DATA

a. Geology

The Cold Spring Dam (Lower) is located in the Hudson Hills segment of the New England Uplands physiographic province of New York State. These hills, commonly known as the "Highlands of the Hudson" are composed of crystalline rocks similar to those in the Adirondacks. The highlands, which trend northeast-southwest, have been eroded to form very rugged terrain with summit levels reaching 1000 feet above sea level. Bedrock in the area consists of gneiss, quartzite, and marble from the Precambrian era (more than 570 million years ago). A review of the Brittle Structures Map of New York indicates that there are two faults within one mile of the dam. These are both fault traces, but no further information was available.

Surficial soils in the area consist of glacial drift from the Wisconsin glaciation.

b. Subsurface Investigations

No records of any subsurface investigations performed for this structure were available. An inspection report from 1939 provided some limited foundation information. The dam had been dewatered at the time of this inspection. The report stated that old concrete on rock formed the foundation at the north end of the structure and iron ore (cemented by oxidation) comprises the foundation at the south end.

2.2. DESIGN RECORDS

There were no records available concerning the original design of this structure. An application for reconstruction of the dam and one plan sheet (included in Appendix F) prepared in 1934 were available. The designer of these revisions was Allan Smith, professional engineer of Cold Spring, New York. The files also contained several letters from representatives of the New York State Department of Public Works, who reviewed the reconstruction plans, to the designer. Minor modifications to the design, such as providing a cutoff to impervious strata were suggested in these letters.

There were several discrepancies between the plan sheet and the as-built cross section of the dam. The most substantial revisions were made on the spillway section. A sketch of the existing spillway section was developed from measurements made at the time of the inspection and has been included in Appendix C.

2.3 CONSTRUCTION RECORDS

No construction records were available for this structure.

2.4 OPERATION RECORDS

No operation records were available for this structure.

2.5 EVALUATION OF DATA

Data used for the preparation of this report was obtained from the Department of Environmental Conservation files and from measurements taken during the visual inspection. The plans available did not accurately reflect the as-built conditions. Therefore, measurements made during the inspection were used to perform some of the analyses required for this report.

SECTION 3: VISUAL INSPECTION

3.1 FINDINGS

a. General

Visual inspection of the Cold Spring Dam (Lower) was conducted on April 22, 1981. The weather was clear and the temperature was in the fifties. The water level at the time of the inspection was slightly above the spillway crest elevation.

b. Dam

This dam is composed of laid up stone with concrete covering the crest and upstream face. The concrete was in satisfactory condition with only minor cracking and spalling at the joints. One crack was noted near the left end of the dam which extended across the entire width of the dam. There were a few stones which had been displaced on the downstream face but generally the face was in good condition. There were several large trees growing along the downstream toe of the dam.

A wet area was observed on the left end of the dam immediately beyond the downstream toe. This area began at the tree adjacent to the spillway channel and extended 100 feet along the toe toward the left end of the dam. While no flow was observed coming from beneath the dam, there were several places where the wet area extended up to or under the toe. The water from this wet area flowed away from the dam through an 18 inch diameter culvert pipe beneath the road near the left end of the wet area.

c. Spillway

The spillway section, having three openings, was in satisfactory condition. The concrete forming the spillway crest on the two outside openings was in good condition. There was some spalling and cracking in the middle opening. Some concrete deterioration was observed around the bases of the piers supporting the bridge over the spillway. The wingwalls separating the spillway channel from the remainder of the dam was also in good condition.

d. Low Level Outlet and Manhole

The manhole and low level outlet were in satisfactory condition. The valve on the 12 inch outlet pipe was reported to be operable. There was minor deterioration of concrete on the manhole. Inspection of the interior revealed several areas of minor leakage into the structure.

e. Reservoir

There were no signs of soil instability in the reservoir area. The Cold Spring Dam (Upper) formed the upstream limit of this reservoir.

f. Downstream Channel

The spillway discharges into a small pool downstream of the dam. Two 21 inch diameter corrugated metal pipes carried flows under the dirt

road downstream of the dam. Beyond the road, the natural channel meanders through woodlands.

3.2 EVALUATION OF OBSERVATIONS

Visual observations revealed several minor deficiencies on this structure. The following items were noted:

1. A wet area at the downstream toe of the dam extending from the edge of the spillway channel about 100 feet toward the left end of the dam.
2. Several large trees growing along the downstream toe of the dam .
3. Several minor cracks in the concrete on the crest of the dam.
4. Deteriorated concrete in the middle opening of the spillway.
5. Minor deterioration and leakage through concrete on the manhole.
6. Limited discharge capacity of the two pipes under the road downstream of the dam.

SECTION 4: OPERATION AND MAINTENANCE PROCEDURES

4.1 PROCEDURES

There are no prescribed operating procedures for this dam. The valve on the low level outlet pipe is opened when water is needed for the Village water supply. Water then flows in Foundry Brook to the treatment plant approximately 2.5 miles downstream of the dam.

4.2 MAINTENANCE OF DAM

This dam is maintained by the Village of Cold Spring. There is no established maintenance plan but work is performed as required by village personnel.

4.3 WARNING SYSTEM IN EFFECT

There is no apparent warning system present for the evacuation of downstream residents.

4.4 EVALUATION

The operations and maintenance procedures on this dam are generally satisfactory. Some increase in maintenance efforts is needed to correct minor deficiencies which exist on this structure.

SECTION 5: HYDROLOGIC/HYDRAULIC

5.1 DRAINAGE AREA CHARACTERISTICS

Delineation of the watershed draining into the reservoir pool was made using the USGS 7.5 minute quadrangle sheet for West Point, New York. The 496 acre drainage area consists primarily of forested lands. The Cold Spring Upper Dam controls the upper 464 acres of the drainage area. Relief is relatively steep in the entire drainage area with slopes of up to 50 per cent. Hilltops within the drainage area rise to elevations of up to 475 feet above the normal lake level.

5.2 ANALYSIS CRITERIA

The analysis of the floodwater retarding capability of this dam was performed using the Corps of Engineers' HEC-1 computer program, Dam Safety version. This program used the Snyder Synthetic hydrograph and the "Modified Puls" flood routing procedure. The spillway design flood selected for analysis was the Probable Maximum Flood (PMF) in accordance with the recommended guidelines of the U.S. Army Corps of Engineers. The PMF event is that hypothetical storm event resulting from the most critical combination of rainfall, minimum soil retention, and direct runoff to a specific site that is considered reasonably possible for a particular watershed. Precipitation values used in the analysis were obtained from the Weather Bureau publication HMR33. Soil retention rates selected were an initial loss of 2.0 inches and a constant loss of 0.16 inches per hour.

For the purposes of this analysis, the drainage area for the dam was divided into two sub-basins. The major portion of the watershed (464 acres) is controlled by the Cold Spring Upper Dam. This area was used as one sub-basin and outflows were routed over the dam. The second sub-basin consisted of the 32 acres downstream of the upper dam.

5.3 SPILLWAY CAPACITY

The dam has an ungated spillway near its right end. The spillway is composed of three openings separated by piers which support a concrete foot bridge across the top of the spillway. The spillway was analyzed as a broad crested weir with a discharge coefficient which varied according to head. The effective length of the spillway was reduced to account for turbulence caused by the piers. The computed spillway capacity for the water surface at the top of the dam is 365 cfs.

5.4 RESERVOIR CAPACITY

Surcharge storage capacity of the reservoir between the spillway crest and the top of the dam is estimated to be 16 acre-feet which is equivalent to a direct runoff depth of 0.39 inches over the drainage area. The total storage capacity of the dam is estimated to be 70 acre-feet.

5.5 FLOODS OF RECORD

No information was available regarding the maximum known flood.

5.6 OVERTOPPING POTENTIAL

Analysis using the PMF and one-half the PMF storm events indicates that the dam does not have sufficient spillway capacity. For the PMF, the peak inflow and outflow are both approximately 1225 cfs. The dam would be overtopped to a computed depth of 0.87 feet for this event. The peak inflow and outflow from one-half the PMF are both about 606 cfs and would result in a depth of overtopping of 0.34 ft. All storms exceeding 31% of the PMF will result in the dam being overtopped.

5.7 EVALUATION

Using the Corps of Engineers' screening criteria for initial review of spillway adequacy, it has been determined that the dam would be overtopped by all storms exceeding 31% of the PMF. Stability analyses performed indicate that the safety factors are less than desirable when the dam is subjected to storms of this magnitude. However, since the analysis does not indicate that the dam is unstable under these loading conditions, the spillway capacity has been rated as inadequate, rather than a more severe assessment.

SECTION 6: STRUCTURAL STABILITY

6.1 EVALUATION OF STRUCTURAL STABILITY

a. Visual Observations

Visual observations revealed no major deficiencies on this structure. Minor cracking and deterioration of concrete was noted on the dam and in the spillway section. There was a wet area which extended for approximately 100 feet along the downstream toe. While no flow was observed coming from beneath the dam, this appeared to be a likely source of the seepage.

b. Data Review and Stability Evaluation

Plans for the 1934 reconstruction of this dam were used in the stability evaluation. However, measurements made at the time of the inspection indicated that the plans do not accurately represent the existing structure. A revised cross section was developed for the structural stability analysis (see Appendix D).

The results of this stability analysis are as follows:

<u>Case</u>	<u>Overturning Safety Factor</u>	<u>Resultant in Middle Third</u>	<u>Sliding Safety Factor</u>
a. Normal conditions, water surface at spillway crest	2.21	Yes	1.89
b. Same as Case a. plus ice load of 5,000 #/ft	1.75	No	1.26
c. 1/2 PMF Flow; water surface 0.34 feet over the top of dam	1.87	No	1.36
d. PMF Flow; water surface 0.87 feet over top of dam	1.84	No	1.29
e. Normal conditions with seismic coefficient	2.15	Yes	1.12

While these analyses do not indicate that the dam is unstable (safety factors below 1.0), they do indicate that the factors of safety are below recommended values (factor of safety for sliding of 3.0 and for overturning resultant force in middle third) for all except normal conditions. A more detailed investigation of the structure is required to better assess the stability of the dam.

This investigation should include subsurface explorations to obtain information about the foundation material and uplift forces. This information should then be incorporated into the stability analysis. Based on the results of this analysis, a determination should be made as to whether modifications to the structure are required.

c. Seismic Stability

This structure is located in Seismic Zone 1. However, a seismic stability analysis was performed in accordance with Corps of Engineer Guidelines. The seismic analysis was performed for normal conditions with the water level at the spillway crest. The results of this analysis (shown on page 11) indicate that the safety factors are below the recommended values although they are above 1.0.

SECTION 7: ASSESSMENT/RECOMMENDATIONS

7.1 ASSESSMENT

a. Safety

The Phase I inspection of the Cold Spring Dam (Lower) revealed several deficiencies. The structural stability analysis performed for this dam indicates that safety factors are below recommended values for all conditions studied. In addition, there was a wet area noted at the downstream toe of the dam which extended for about 100 feet from the edge of the spillway channel toward the left end of the dam. Other deficiencies noted, such as deteriorated concrete, were of a minor nature.

This dam will be overtopped by flows resulting from all storms exceeding 31% of the PMF. The stability analyses performed indicate that when the dam is subjected to flows resulting from one-half the PMF, the safety factors are below recommended values. However, the analysis does not indicate that the dam is unstable under these loading conditions. The spillway capacity has, therefore, been rated as inadequate.

b. Adequacy of Information

The information which was available did not accurately reflect all aspects of the structure as it exists. Field measurements made at the time of the inspection uncovered several discrepancies between the plans and the actual dimensions. Revised cross sections based on field measurements were used to perform the analyses for this report. Some of the data used for the hydrologic/hydraulic analysis was based on estimates as well.

c. Need for Additional Investigations

Further investigations of the structural stability of this dam are required. These studies should include subsurface explorations to obtain information about the dam's foundation and uplift forces. This data should then be incorporated into a detailed stability evaluation. Investigations are also required to determine the cause and severity of the wet area at the downstream toe of the dam.

d. Urgency

Investigations of the structural stability and of the wet area should be commenced within 3 months of the date of the notification of the owner. Remedial measures deemed necessary as a result of these investigations should be completed within 18 months. Other deficiencies noted in section 7.2 should be corrected within 12 months of the date of the notification of the owner.

7.2 RECOMMENDED MEASURES

1. After the structural stability analysis has been completed, appropriate remedial measures should be taken.
2. Based on the findings of the investigation into the wet area on the downstream toe, corrective actions should be taken.
3. Large trees growing along the downstream toe of the dam should be cut.
4. Deteriorated concrete and cracks on the crest should be repaired.
5. Minor deterioration and leakage through the concrete on the manhole should be kept under surveillance.
6. An emergency action plan for the notification of downstream residents should be developed and implemented.

APPENDIX A

PHOTOGRAPHS



UPSTREAM FACE OF DAM



DOWNSTREAM FACE OF DAM
WET AREA AT TOE OF DAM



VIEW OF CREST FROM LEFT END OF DAM



CRACK IN CONCRETE ON CREST OF DAM



DOWNSTREAM FACE OF DAM; SPILLWAY SECTION
NEAR CENTER OF PICTURE



SPILLWAY SECTION; NOTE LOW LEVEL OUTLET PIPE AT
BASE OF DAM




SPILLWAY SECTION OF DAM
LOWER LEVEL OUTLET PIPE AND TWO
CULVERTS UNDER ROAD, DOWNSTREAM OF DAM



LOW LEVEL OUTLET PIPE AT BASE OF SPILLWAY SECTION
NOTE LARGER OPENING WHICH PIPE IS WITHIN



CONCRETE MANHOLE WITH GATE MECHANISM ON
UPSTREAM FACE OF DAM

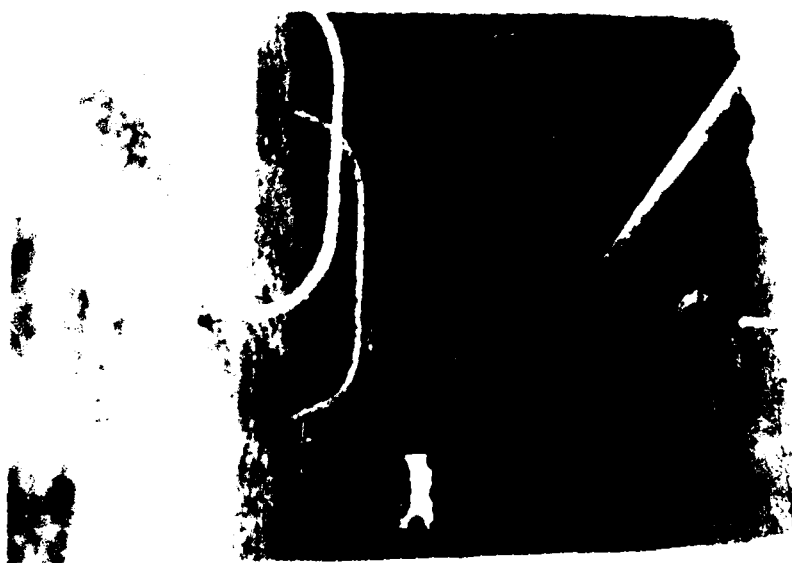

INTERIOR OF MANHOLE, NOTE MINOR LEAKAGE
AT BASE

APPENDIX B

VISUAL INSPECTION CHECKLIST

VISUAL INSPECTION CHECKLIST1) Basic Data

a. General

Name of Dam COLD SPRING DAM (LOWER)
Fed. I.D. # 107 DEC Dam No. #213-1004L
River Basin LOWER HUDSON
Location: Town PHILIPSTOWN County PUTNAM
Stream Name BOUNDARY BROOK
Tributary of _____
Latitude (N) 41° 27.9' Longitude (W) 73° 56.3'
Type of Dam MASONRY AND CONCRETE
Hazard Category C
Date(s) of Inspection 4/22/81
Weather Conditions 50° SUNNY
Reservoir Level at Time of Inspection 2.5' BELOW CREST

b. Inspection Personnel R. WARRENDER W. LYNICK

c. Persons Contacted (Including Address & Phone No.)

<u>MR. RONALD Mc CONVILLE, MAYOR</u>	<u>JOHN BUYNES-CONSULTING</u> ^{ENG.}
<u>COLD SPRING, N.Y. 10516</u>	<u>UPPER STA. ROAD</u>
<u>914-265-3611</u>	<u>GARRISON, N.Y. 10524</u>
	<u>914-424-3652</u>

d. History:

Date Constructed ABOUT 1840 Date(s) Reconstructed 1939

Designer ALLAN SMITH

Constructed By _____

Owner VILLAGE OF COLD SPRING

93-15-3(9/80) NO EMBANKMENT - THEREFORE SECTION 2 NOT COMPLETED 4

(1) Erosion at Contact _____

(2) Seepage Along Contact _____

3) Drainage System

a. Description of System NONE

b. Condition of System _____

c. Discharge from Drainage System _____

4) Instrumentation (Monumentation/Surveys, Observation Wells, Weirs, Piezometers, Etc.)

NONE

5) Reservoir

- a. Slopes SATISFACTORY
- b. Sedimentation NO MAJOR DEPOSITS NOTED
- c. Unusual Conditions Which Affect Dam UPPER DAM IS AT UPSTREAM END OF THIS RESERVOIR

6) Area Downstream of Dam

- a. Downstream Hazard (No. of Homes, Highways, etc.) 2 HOUSES IMMEDIATELY DOWNSTREAM - SEVERAL OTHERS FURTHER DOWNSTREAM
- b. Seepage, Unusual Growth WET AREA ALONG TOE TO LEFT OF SPILLWAY CHANNEL
- c. Evidence of Movement Beyond Toe of Dam NONE
- d. Condition of Downstream Channel SATISFACTORY - TWO 21" CMP'S CARRY FLOWS UNDER DIRT ROAD DOWNSTREAM OF DAM

7) Spillway(s) (Including Discharge Conveyance Channel)

UNCONTROLLED OVERFLOW SECTION

- a. General SPILLWAY IN THREE SECTIONS DIVIDED BY CONCRETE PIERS - CONCRETE WALKWAY GOES ACROSS TOP
- b. Condition of Service Spillway SATISFACTORY CONDITION WITH ONLY MINOR DETERIORATION - AROUND BASE OF PIERS.
- CREST CONCRETE ON TWO OUTSIDE BAYS IN GOOD CONDITION; MIDDLE BAY CONCRETE IS SPALLED AND CRACKED WITH HOLES IN MIDDLE BAY

c. Condition of Auxiliary Spillway NONEd. Condition of Discharge Conveyance Channel SATISFACTORY8) Reservoir Drain/Outlet - LOW LEVEL OUTLETType: Pipe ☒ Conduit _____ Other _____Material: Concrete _____ Metal ☒ Other _____Size: 12" THROUGH RECTANGULAR
OPENING Length _____

Invert Elevations: Entrance _____ Exit _____

Physical Condition (Describe): _____ Unobservable ☒

Material: _____

Joints: _____ Alignment _____

Structural Integrity: _____

Hydraulic Capability: _____

Means of Control: Gate _____ Valve ☒ Uncontrolled _____Operation: Operable ☒ Inoperable _____ Other _____Present Condition (Describe): PIPE EXTENDS FROM GATEHOUSE ON
U.S. FACE TO D.S. FACE OF DAM - SERVES AS WATER
SUPPLY LINE

9) Structural

- a. Concrete Surfaces SATISFACTORY OVERALL - MINOR CRACKING AND SPALLING AT JOINTS
- b. Structural Cracking ONE NARROW CRACK EXTENDS ACROSS CREST & DOWN UPSTREAM FACE
- c. Movement - Horizontal & Vertical Alignment (Settlement) ALIGNMENT SATISFACTORY WITH ONLY MINOR IRREGULARITIES
- d. Junctions with Abutments or Embankments SATISFACTORY - LOW AREA AT LEFT END OF DAM WOULD PERMIT FLOW AROUND END FOR ABOUT 50' BEFORE DAM WAS OVERTOPPED
- e. Drains - Foundation, Joint, Face NONE
- f. Water Passages, Conduits, Sluices CONDUIT THROUGH RECTANGULAR OPENNING - SEE LOW LEVEL OUTLET SECTION
- g. Seepage or Leakage WET AREA AT TOE ON LEFT END - EXTENDS FROM EDGE OF SPILLWAY CHANNEL TOWARD LEFT END FOR ABOUT 100 FEET. NO ACTUAL FLOWS FROM BENEATH DAM WERE NOTED, BUT THERE WERE SEVERAL PLACES WHERE ^{WET AREA} WENT NEAR OR UNDER TOE; AREA DRAINS THROUGH CULVERT PIPE UNDER ROAD

- h. Joints - Construction, etc. SOME DETERIORATION ON JOINTS
- i. Foundation SATISFACTORY
- j. Abutments OKAY
- k. Control Gates GATE FOR LOW LEVEL OUTLET PIPE IS IN GATE HOUSE
ON U.S. FACE - SOME DETERIORATION OF CONCRETE ON GATEHOUSE
SOME MINOR LEAKAGE INTO GATEHOUSE
- l. Approach & Outlet Channels
- m. Energy Dissipators (Plunge Pool, etc.) NONE
- n. Intake Structures
- o. Stability
- p. Miscellaneous 6 LARGE TREES IMMEDIATELY
DOWNSTREAM OF TOE OF DAM

10) APPURTENANT STRUCTURES - NONE

APPENDIX C

HYDROLOGIC/HYDRAULIC
ENGINEERING DATA AND COMPUTATIONS

CHECK LIST FOR DAMS
HYDROLOGIC AND HYDRAULIC
ENGINEERING DATA

1

AREA-CAPACITY DATA:

	<u>Elevation</u> (ft.)	<u>Surface Area</u> (acres)	<u>Storage Capacity</u> (acre-ft.)
1) Top of Dam	<u>628.5</u>	<u>12</u>	<u>70</u>
2) Design High Water (Max. Design Pool)	<u> </u>	<u> </u>	<u> </u>
3) Auxiliary Spillway Crest	<u>626.0</u>	<u>9.2</u>	<u>53.7</u>
4) Pool Level with Flashboards	<u> </u>	<u> </u>	<u> </u>
5) Service Spillway Crest	<u> </u>	<u> </u>	<u> </u>

DISCHARGES

	<u>Volume</u> (cfs)
1) Average Daily	<u>N/A</u>
2) Spillway @ Maximum High Water	<u>365</u>
3) Spillway @ Design High Water	<u>N/A</u>
4) Spillway @ Auxiliary Spillway Crest Elevation	<u>N/A</u>
5) Low Level Outlet	<u>13</u>
6) Total (of all facilities) @ Maximum High Water	<u>365</u>
7) Maximum Known Flood	<u>N/A</u>
8) At Time of Inspection	<u>N/A</u>

CREST:

ELEVATION: 628.5Type: CONCRETE OVER LAID UP STONEWidth: 15 FT Length: 330 FTSpillover CONCRETE CHANNELLocation NEAR RIGHT END OF DAM

SPILLWAY:

SERVICE

AUXILIARY

626

Elevation

N/ACONCRETE CHANNEL

Type

31.25 FT

Width

Type of Control

V

Uncontrolled

Controlled:

Type

(Flashboards; gate)

Number

Size/Length

Invert Material

Anticipated Length
of operating service

Chute Length

Height Between Spillway Crest
& Approach Channel Invert
(Weir Flow)

HYDROMETEROLOGICAL GAGES:

Type : NONE

Location: _____

Records:

Date - _____

Max. Reading - _____

FLOOD WATER CONTROL SYSTEM:

Warning System: NONE

Method of Controlled Releases (mechanisms):

RELEASE THROUGH LOW LEVEL OUTLET
PIPE NEAR BASE OF DAM

DRAINAGE AREA: 496 ACRES 0.77 Sq. Mi

DRAINAGE BASIN RUNOFF CHARACTERISTICS:

Land Use - Type: FOREST

Terrain - Relief: VERY STEEP

Surface - Soil: ROCK & SHALLOW COVER SOIL

Runoff Potential (existing or planned extensive alterations to existing surface or subsurface conditions)

NONE

Potential Sedimentation problem areas (natural or man-made; present or future)

NONE

Potential Backwater problem areas for levels at maximum storage capacity including surcharge storage:

NONE

Dikes - Floodwalls (overflow & non-overflow) - Low reaches along the Reservoir perimeter:

Location: NONE

Elevation: _____

Reservoir:

Length @ Maximum Pool _____ (Miles)

Length of Shoreline (@ Spillway Crest) _____ (Miles)

PROJECT GRID

JOB	COLD SPRING LOWER RESERVOIR DAM	SHEET NO.	1	CHECKED BY		DATE	
SUBJECT	WATERSHED PARAMETERS			COMPUTED BY	RLW	DATE	6/3/61
DRAINAGE AREA - USE 2 SUBBASINS							
SUB BASIN No. 1 - DRAINAGE AREA FOR COLD SPRING (UPPER)							
NY 106							
$A_1 = 463.7 \text{ ACRES} = .72 \text{ SQ. MI}$							
SUB BASIN No. 2 - DOWNSTREAM OF UPPER DAM							
$A_2 = 32.2 \text{ ACRES} = .055 \text{ SQ. MI}$							
BASE FLOW:							
INITIAL AT 1 CSM = 1 CFS							
$Q_{RCSN} = .1 \text{ (10\% OF PEAK Q)}$							
PTIGR = 1.5							
LOSSES (SOIL INFILTRATION)							
UPPER BASIN				LOWER BASIN			
INITIAL = 2.0				INITIAL = 1.0			
CONSTANT = 0.1				CONSTANT = 0.1			
2 FROM CORP. LOWER							
3 UNDOGA STUDY							
USING FISHAILL CASE							
RAINFALL - PMF				$\% \text{ IMPERVIOUS} = \frac{9.2 \text{ ACRES}}{36.2 \text{ ACRES}} = 0.28$			
REF: HMR #33				$\% \text{ OF BASIN WHICH IS RESERVOIR \& HAS NO INFILTRATION}$			
ZONE 1				INDEX PMF = 21.4 (200 SQ MI / 24 HR)			
ADJUSTMENT FOR TIME				DURATION → 6 12 24 48			
E DA				% OF INDEX → 111 123 132 142			

PROJECT GRID

JOB		SHEET NO.	CHECKED BY	DATE
COLD SPRING LOWER RESERVOIR DAM		2		
SUBJECT		COMPUTED BY	DATE	
WATERSHED PARAMETERS		RLW	6/3/81	
SNYDER UNIT HYDROGRAPH PARAMETERS				
SUB BASIN 1 - UPPER RESERVOIR		SUB BASIN 2 - LOWER RESERVOIR		
$L = 1.36 \text{ mi} = 7181 \text{ ft}$		$L = 1400 \text{ ft} = 0.26 \text{ mi}$		
$L_{CA} = 0.83 \text{ mi} = 4387 \text{ ft}$		$L_{CA} = 500 \text{ ft} = 0.09 \text{ mi}$		
USE $C_1 = 2.4$ ← FROM CORPS LOWER HUDSON BASIN STUDY		USE $C_1 = 2.4$ FROM BASIN STUDY		
LAG TIME (HRS):		LAG TIME (HRS):		
$t_p = C_1 (L \times L_{CA})^{0.3}$		$t_p = 2.4 [0.26 \times 0.09]^{0.3} = 0.78 \text{ HRS}$		
$= 2.4 [1.36 \times 0.83]^{0.3} = 2.49 \text{ HRS}$				
UNIT RAINFALL DURATION = $\frac{t_p}{5.5}$		UNIT RAINFALL DURATION		
$t_r = \frac{2.49}{5.5} = 0.45 \text{ HRS}$		$t_r = \frac{0.78}{5.5} = 0.14$		
$t_r = 0.35 \text{ hrs} \leftarrow \text{USE } 0.50 \text{ HOURS}$		$t_r = 0.14 \text{ hrs} \leftarrow \text{USE } 0.50 \text{ HOURS}$		
ADJUSTED LAG TIME (HOURS)		ADJUSTED LAG TIME (HOURS)		
$T_P = t_p + .25(t_r - t_c)$		$T_P = 0.78 + .25(.50 - .14) = .87$		
$= 2.49 + .25(.50 - .15) = 2.50$				
PEAKING COEFFICIENT		PEAKING COEFFICIENT		
USE $C_2 = 0.625$		USE $C_2 = 0.625$		
SNYDER COEFFICIENTS		SNYDER COEFFICIENTS		
$T_P = 2.50$ $C_P = 0.44$		$T_P = 0.87$ $C_P = 0.625$		

PROJECT GRID

JOB	COLD SPRING LOWER RESERVOIR DAM	SHEET NO.	3	CHECKED BY		DATE	
SUBJECT	STAGE-STORAGE & STAGE DISCHARGE DATA			COMPUTED BY	RLW	DATE	6/3/81
SURFACE AREA (BASED ON USGS SHEET)							
NORMAL POOL (ELEV. 626)				$= 0.10 \text{ IN}^2 = 9.2 \text{ ACRES}$			
ELEV 640 CONTOUR LINE				$= 0.15 \text{ IN}^2 = 13.8 \text{ ACRES}$			
COMPUTED STORAGE CAPACITY							
HEIGHT TO SPILLWAY CREST (NORMAL WATER) $= 17.5 \text{ FT}$							
$V = \frac{\text{AREA}(\text{HEIGHT})}{3} = \frac{9.2 \text{ ACRES}(17.5 \text{ FT})}{3} = 53.7 \text{ AC} \cdot \text{FT}$							
CAPACITY AT 640 CONTOUR							
$V = \frac{(13.8 \text{ ACRES})(9.5)}{3} = 144.9 \text{ AC} \cdot \text{FT}$							
SPILLWAY DISCHARGE							
SPILLWAY WILL ACT AS A BROAD CRESTED WEIR							
$Q = CLH^{3/2}$							
$L = L' - 2(NK_p + K_d)H \Rightarrow L = 31.25 - 2[0.04 + .2]H = 31.25 - .48H$							
$L' = 31.25 \quad N = 2 \quad K_p = 0.02 \quad K_d = 0.20$							
$C \rightarrow$ VARIES WITH HEAD - USE TABLE 5-3 KING & BRATER							
TAKE BREADTH OF CREST $= 2'$							

PROJECT GRID

JOB COLD SPRING LOWER RESERVOIR DAM		SHEET NO. 4		CHECKED BY	DATE
SUBJECT SPILLWAY DISCHARGE CURVE				COMPUTED BY RLW	DATE 6/4/81

ELEVATION	H	L	C	Q (CF3)
626	0	—	—	—
	0.5	31.01	2.61	28.6
	1	30.77	2.66	81.8
	1.5	30.53	2.83	158.7
	2	30.29	2.85	244.2
628.5	2.5	30.05	3.07	369.7
	3.0	29.81	3.20	495.7
	3.5	29.57	3.32	642.8
	4.0	29.33	3.32	779.0
	5.0	28.85	3.32	1070.9

Top of Dam

COMPUTE DISCHARGE CAPACITY OF LOW LEVEL OUTLET PIPE

12 INCH DIAMETER CAST IRON PIPE L = 30' n = 0.015 A = 7854 ft²

S = 0.0425

ASSUME INVERTS: INLET = 708.6

OUTLET = 707.5

PIPE FLOW

$$Z_1 + \frac{P_1}{\gamma} + \sum \frac{V_1^2}{2g} = Z_2 + \frac{P_2}{\gamma} + \sum \frac{V_2^2}{2g} + \sum h_L$$

P₁ = 0 V₁ = 0 P₂ = 0 h_L = K $\frac{V^2}{2g}$

$$Z_1 - Z_2 = \sum K \frac{V^2}{2g}$$

CONTINUED ON NEXT PAGE

PROJECT GRID

JOB	SHEET NO.	CHECKED BY	DATE
COLD SPRING LOWER RESERVOIR DAM	5		
SUBJECT	COMPUTED BY	DATE	
LOW LEVEL OUTLET DISCHARGE COMPUTATIONS	RLW	6/4/81	

CALCULATE CAPACITY FOR WATER SURFACE AT SPILLWAY CREST (ELEV. 626)
(ASSUME GATE IS FULLY OPEN)

$$Z_1 - Z_2 = K \frac{V^2}{2g} + \sum K \frac{V^2}{2g}$$

$$726 - 708.6 = \frac{V^2}{2g} + \left[\overset{\text{ENTRANCE}}{2.5} + \overset{\text{PIPE}}{1.28} + \overset{\text{VALVE}}{0.19} + \overset{\text{EXIT}}{1.0} \right] \frac{V^2}{2g}$$

$$17.4 = [1 + 2.97] \frac{V^2}{2g}$$

$$V = 16.8 \text{ fps}$$

$$A = .7854$$


$$Q = 13.2 \text{ cfs}$$

COLD SPRING DAM (LOWER)


N.Y. 106

SPILLWAY SECTION

SCALE 1" = 5'

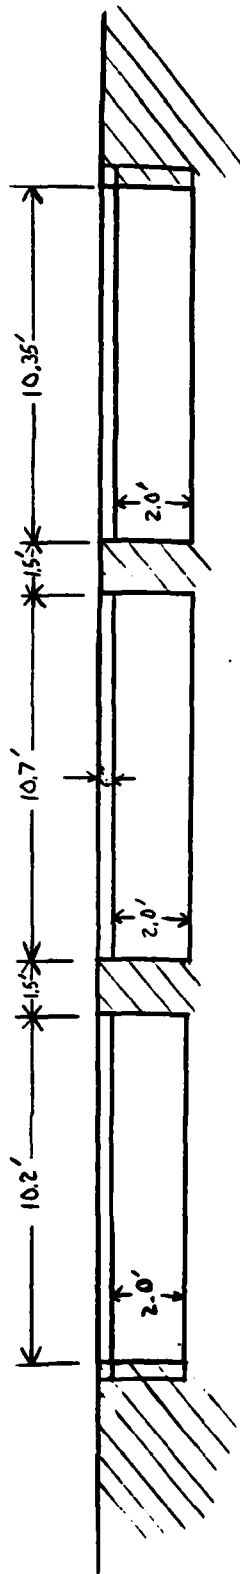

CROSS SECTION AT SPILLWAY

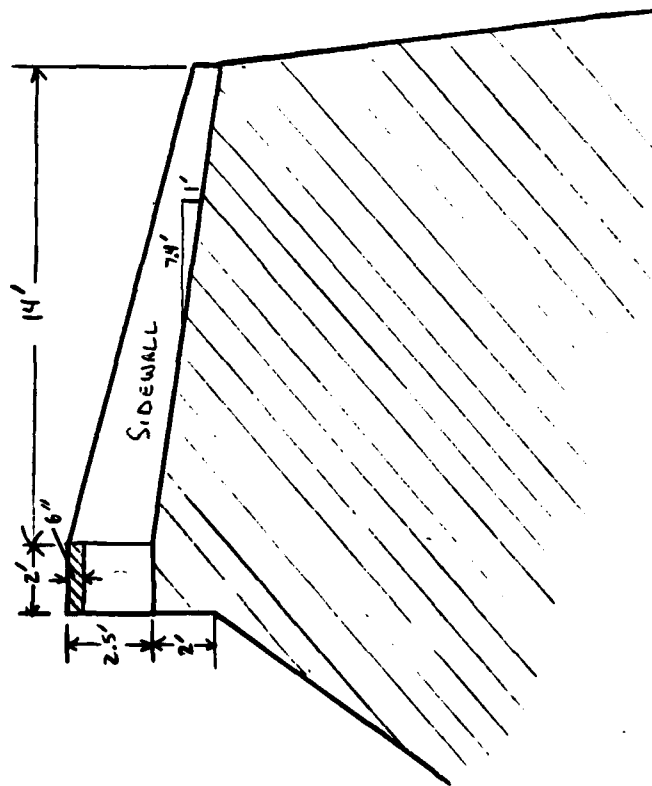

NEW YORK STATE
DEPT OF ENVIRONMENTAL CONSERVATION
FLOOD PROTECTION BUREAU

 FLEGG HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79
 MODIFIED FOR HONEYWELL APR 79

A1 NY 107 COLD SPRING JAM LOWER
A2 HEC-1 PMF WITH RATIOS
A3 DATE
B 150 0 30
B1 5

9	1	4	1
91	.31	.32	.50
			1.0

104

K1 INFLOW HYDROGRAPH UPPER RESERVOIR

MM 1 1 .1 .72

P	21.4	111	123	132	142
---	------	-----	-----	-----	-----

11 2.0 0.16

U 2.5 .44

X 1 -1 1.5

K 1 UPDAM

K1 ROUTED HYDROGRAPH UPPER DAM

Y I I

111 -64/ -1

[illegible]

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21
22
23
24
25
26
27
28
29
30
31
32
33
34
35
36
37
38
39
40
41
42
43
44
45
46
47
48
49
50
51
52
53
54
55
56
57
58
59
60
61
62
63
64
65
66
67
68
69
70
71
72
73
74
75
76
77
78
79
80
81
82
83
84
85
86
87
88
89
90
91
92
93
94
95
96
97
98
99
100
101
102
103
104
105
106
107
108
109
110
111
112
113
114
115
116
117
118
119
120
121
122
123
124
125
126
127
128
129
130
131
132
133
134
135
136
137
138
139
140
141
142
143
144
145
146
147
148
149
150
151
152
153
154
155
156
157
158
159
160
161
162
163
164
165
166
167
168
169
170
171
172
173
174
175
176
177
178
179
180
181
182
183
184
185
186
187
188
189
190
191
192
193
194
195
196
197
198
199
200
201
202
203
204
205
206
207
208
209
210
211
212
213
214
215
216
217
218
219
220
221
222
223
224
225
226
227
228
229
230
231
232
233
234
235
236
237
238
239
240
241
242
243
244
245
246
247
248
249
250
251
252
253
254
255
256
257
258
259
260
261
262
263
264
265
266
267
268
269
270
271
272
273
274
275
276
277
278
279
280
281
282
283
284
285
286
287
288
289
290
291
292
293
294
295
296
297
298
299
300
301
302
303
304
305
306
307
308
309
310
311
312
313
314
315
316
317
318
319
320
321
322
323
324
325
326
327
328
329
330
331
332
333
334
335
336
337
338
339
340
341
342
343
344
345
346
347
348
349
350
351
352
353
354
355
356
357
358
359
360
361
362
363
364
365
366
367
368
369
370
371
372
373
374
375
376
377
378
379
380
381
382
383
384
385
386
387
388
389
390
391
392
393
394
395
396
397
398
399
400
401
402
403
404
405
406
407
408
409
410
411
412
413
414
415
416
417
418
419
420
421
422
423
424
425
426
427
428
429
430
431
432
433
434
435
436
437
438
439
440
441
442
443
444
445
446
447
448
449
450
451
452
453
454
455
456
457
458
459
460
461
462
463
464
465
466
467
468
469
470
471
472
473
474
475
476
477
478
479
480
481
482
483
484
485
486
487
488
489
490
491
492
493
494
495
496
497
498
499
500
501
502
503
504
505
506
507
508
509
510
511
512
513
514
515
516
517
518
519
520
521
522
523
524
525
526
527
528
529
530
531
532
533
534
535
536
537
538
539
540
541
542
543
544
545
546
547
548
549
550
551
552
553
554
555
556
557
558
559
560
561
562
563
564
565
566
567
568
569
570
571
572
573
574
575
576
577
578
579
580
581
582
583
584
585
586
587
588
589
590
591
592
593
594
595
596
597
598
599
600
601
602
603
604
605
606
607
608
609
610
611
612
613
614
615
616
617
618
619
620
621
622
623
624
625
626
627
628
629
630
631
632
633
634
635
636
637
638
639
640
641
642
643
644
645
646
647
648
649
650
651
652
653
654
655
656
657
658
659
660
661
662
663
664
665
666
667
668
669
670
671
672
673
674
675
676
677
678
679
680
681
682
683
684
685
686
687
688
689
690
691
692
693
694
695
696
697
698
699
700
701
702
703
704
705
706
707
708
709
710
711
712
713
714
715
716
717
718
719
720
721
722
723
724
725
726
727
728
729
730
731
732
733
734
735
736
737
738
739
740
741
742
743
744
745
746
747
748
749
750
751
752
753
754
755
756
757
758
759
760
761
762
763
764
765
766
767
768
769
770
771
772
773
774
775
776
777
778
779
780
781
782
783
784
785
786
787
788
789
790
791
792
793
794
795
796
797
798
799
800
801
802
803
804
805
806
807
808
809
810
811
812
813
814
815
816
817
818
819
820
821
822
823
824
825
826
827
828
829
830
831
832
833
834
835
836
837
838
839
840
84

100

33

US 649-4

202

K1 INFLCW HYDRCGA

11 1 .05

P 21.4 111

W : .87 .625

[illegible]

PREVIEW OF SEQUENCE OF STREAM NETWORK CALCULATIONS

RUNOFF HYDROGRAPH AT 1
ROUTE HYDROGRAPH TO UPOAH
RUNOFF HYDROGRAPH AT 2
COMBINE 2 HYDROGRAPHS AT COMB
ROUTE HYDROGRAPH TO LCMOAH
END OF NETWORK

.....
 NEW YORK STATE
 DEPT OF ENVIRONMENTAL CONSERVATION
 FLOOD PROTECTION BUREAU

.....
 FLOOD HYDROGRAPH PACKAGE (HEC-1)
 DAM SAFETY VERSION JULY 1978
 LAST MODIFICATION 26 FEB 79
 MODIFIED FOR HONEYWELL APR 79

RUN DATE 08/12/81

NY 107 COLD SPRING DAM LOWER
 HEC-1 PMF WITH RATIOS
 DATE

JO3 SPECIFICATION
 NO NHR NMIN IDAY IMR IMIN METRC
 150 0 30 0 0 0 0
 JUPER NWT LROPT TRACE
 5 0 0 0

MULTI-PLAN ANALYSES TO BE PERFORMED
 VPLAN= 1 NRTIO= 4 LRTIO= 1
 RTIOS= 0.31 0.32 0.50 1.00

.....

SUB-AREA RUNOFF COMPUTATION

INFLOW HYDROGRAPH UPPER RESERVOIR
 ISTAQ ICOMP IECON ITAPE JPLT JPRT INAME ISTAGE IAUTO
 1 0 0 0 0 0 0 1 0 0

HYDROGRAPH DATA
 IHYCG ICHG IAREA SNAP TRSDA TRSPC RATIO ISNOW ISATE LOCAL
 1 1 6.72 0. 0.72 0. 0. 0 1 0

PRECIP DATA
 SPFE FMS R6 R12 R24 R48 R72 R96
 0. 21.40 111.00 123.00 132.00 142.00 0. 0.

TRSPC COMPUTED BY THE PROGRAM IS 0.800

LOSS DATA
 LROPT STAKR DLTKR RTIOL ERAIN STRKS RTICK STRTL CNSIL ALSHX RTIMP
 0 0. 0. 1.00 0. 0. 1.00 2.00 0.16 0. 0.

UNIT HYDROGRAPH DATA
 TP= 2.50 CP=0.44 NTA= 0

RECESSION DATA
 START2= 1.00 ORCSN= -0.10 RTIOR= 1.50

APPROXIMATE CLARK COEFFICIENTS FROM GIVEN SNYDER CP AND TP ARE TC= 5.40 AND RE= 8.09 INTERVALS

UNIT HYDROGRAPH 46 END-OF-PERIOD ORDINATES, LAG= 2.51 HOURS, CP= 0.44 VOL= 1.00
 5. 23. 45. 57. 80. 81. 73. 54. 57. 50.
 44. 35. 31. 27. 24. 21. 19. 17. 15.
 13. 11. 10. 9. 8. 6. 5. 4. 4.
 4. 3. 3. 2. 2. 2. 2. 1. 1.
 1. 1. 1. 1. 1. 1. 1. 1. 1.

END-OF-PERIOD FLOW

MO-DA	HR-MN	PERIOD	RAIN	EXCS	LOSS	COMP Q	MO-DA	HR-MN	PERIOD	RAIN	EXCS	LOSS	COMP Q
1.01	0.30	1	0.00	0.	0.00	1.	1.02	14.00	75	1.14	1.06	0.08	183.
1.01	1.00	2	0.00	0.	0.00	1.	1.02	14.30	77	1.43	1.35	0.08	258.
1.01	1.30	3	0.03	0.	0.30	1.	1.02	15.00	78	1.43	1.35	0.08	342.
1.01	2.00	4	0.00	0.	0.30	1.	1.02	15.30	79	1.73	1.55	0.08	430.
1.01	2.30	5	0.00	0.	0.00	1.	1.02	16.00	80	5.49	5.41	0.08	546.
1.01	3.00	6	0.00	0.	0.00	1.	1.02	16.30	81	1.33	1.25	0.08	762.
1.01	3.30	7	0.00	0.	0.00	1.	1.02	17.00	82	1.33	1.25	0.08	874.
1.01	4.00	8	0.00	0.	0.30	1.	1.02	17.30	83	1.05	0.97	0.08	1027.
1.01	4.30	9	0.00	0.	0.00	1.	1.02	18.00	84	1.05	0.97	0.08	1128.
1.01	5.00	10	0.00	0.	0.00	1.	1.02	18.30	85	0.09	0.	0.08	1154.
1.01	5.30	11	0.00	0.	0.00	1.	1.02	19.00	86	0.08	0.	0.08	1117.
1.01	6.00	12	0.00	0.	0.00	1.	1.02	19.30	87	0.08	0.	0.08	1048.
1.01	6.30	13	0.01	0.	0.01	1.	1.02	20.00	88	0.08	0.	0.08	958.
1.01	7.00	14	0.01	0.	0.01	1.	1.02	20.30	89	0.08	0.	0.08	858.
1.01	7.30	15	0.01	0.	0.01	1.	1.02	21.00	90	0.08	0.	0.08	759.
1.01	8.00	16	0.01	0.	0.01	1.	1.02	21.30	91	0.08	0.	0.08	671.
1.01	8.30	17	0.01	0.	0.01	1.	1.02	22.00	92	0.08	0.	0.08	592.
1.01	9.00	18	0.01	0.	0.01	0.	1.02	22.30	93	0.08	0.	0.08	524.
1.01	9.30	19	0.01	0.	0.01	0.	1.02	23.00	94	0.08	0.	0.08	463.
1.01	10.00	20	0.01	0.	0.01	0.	1.02	23.30	95	0.08	0.	0.08	405.
1.01	10.30	21	0.01	0.	0.01	0.	1.03	0.	96	0.08	0.	0.08	361.
1.01	11.00	22	0.01	0.	0.01	0.	1.03	0.30	97	0.	0.	0.	319.
1.01	11.30	23	0.01	0.	0.01	0.	1.03	1.00	98	0.	0.	0.	282.
1.01	12.00	24	0.01	0.	0.01	0.	1.03	1.30	99	0.	0.	0.	245.
1.01	12.30	25	0.07	0.	0.07	0.	1.03	2.00	100	0.	0.	0.	220.
1.01	13.00	26	0.07	0.	0.07	0.	1.03	2.30	101	0.	0.	0.	195.
1.01	13.30	27	0.09	0.	0.09	0.	1.03	3.00	102	0.	0.	0.	172.
1.01	14.00	28	0.09	0.	0.09	0.	1.03	3.30	103	0.	0.	0.	152.
1.01	14.30	29	0.11	0.	0.11	0.	1.03	4.00	104	0.	0.	0.	134.
1.01	15.00	30	0.11	0.	0.11	0.	1.03	4.30	105	0.	0.	0.	119.
1.01	15.30	31	0.13	0.	0.13	0.	1.03	5.00	106	0.	0.	0.	112.
1.01	15.00	32	0.42	0.	0.42	0.	1.03	5.30	107	0.	0.	0.	107.
1.01	16.30	33	0.10	0.	0.10	0.	1.03	6.00	108	0.	0.	0.	103.
1.01	17.00	34	0.10	0.	0.10	0.	1.03	6.30	109	0.	0.	0.	99.
1.01	17.30	35	0.09	0.	0.08	0.	1.03	7.00	110	0.	0.	0.	95.
1.01	18.00	36	0.08	0.	0.08	0.	1.03	7.30	111	0.	0.	0.	91.
1.01	16.30	37	0.01	0.	0.01	0.	1.03	8.00	112	0.	0.	0.	88.
1.01	19.00	38	0.01	0.	0.01	0.	1.03	8.30	113	0.	0.	0.	84.
1.01	19.30	39	0.01	0.	0.01	0.	1.03	9.00	114	0.	0.	0.	81.
1.01	20.00	40	0.01	0.	0.01	0.	1.03	9.30	115	0.	0.	0.	78.
1.01	20.30	41	0.01	0.	0.01	0.	1.03	10.00	116	0.	0.	0.	75.
1.01	21.00	42	0.01	0.	0.01	0.	1.03	10.30	117	0.	0.	0.	72.
1.01	21.30	43	0.01	0.	0.01	0.	1.03	11.00	118	0.	0.	0.	69.
1.01	22.00	44	0.01	0.	0.01	0.	1.03	11.30	119	0.	0.	0.	66.
1.01	22.30	45	0.01	0.	0.01	0.	1.03	12.00	120	0.	0.	0.	63.
1.01	23.00	46	0.01	0.	0.01	0.	1.03	12.30	121	0.	0.	0.	61.
1.01	23.30	47	0.01	0.	0.01	0.	1.03	13.00	122	0.	0.	0.	58.
1.02	0.	48	0.01	0.	0.01	0.	1.03	13.30	123	0.	0.	0.	56.
1.02	0.30	49	0.05	0.	0.05	0.	1.03	14.00	124	0.	0.	0.	54.
1.02	1.00	50	0.05	0.	0.05	0.	1.03	14.30	125	0.	0.	0.	52.
1.02	1.30	51	0.05	0.	0.05	0.	1.03	15.00	126	0.	0.	0.	50.
1.02	2.00	52	0.05	0.	0.05	0.	1.03	15.30	127	0.	0.	0.	48.
1.02	2.30	53	0.05	0.	0.05	0.	1.03	16.00	128	0.	0.	0.	46.
1.02	3.00	54	0.05	0.	0.05	0.	1.03	16.30	129	0.	0.	0.	44.
1.02	3.30	55	0.05	0.	0.05	0.	1.03	17.00	130	0.	0.	0.	42.
1.02	4.00	56	0.05	0.	0.05	0.	1.03	17.30	131	0.	0.	0.	41.
1.02	4.30	57	0.05	0.	0.05	0.	1.03	18.00	132	0.	0.	0.	39.
1.02	5.00	58	0.05	0.	0.05	0.	1.03	18.30	133	0.	0.	0.	37.
1.02	5.30	59	0.05	0.	0.05	0.	1.03	19.00	134	0.	0.	0.	36.
1.02	6.00	60	0.05	0.	0.05	0.	1.03	19.30	135	0.	0.	0.	35.

X

◆ ◆ ◆ ◆ ◆

...

1
2
3
4
5

3

3

•
•
•
•

•
•
•
•

1
 2
 3
 4
 5
 6
 7
 8
 9
 10
 11
 12
 13
 14
 15
 16
 17
 18
 19
 20
 21
 22
 23
 24
 25
 26
 27
 28
 29
 30
 31
 32
 33
 34
 35
 36
 37
 38
 39
 40
 41
 42
 43
 44
 45
 46
 47
 48
 49
 50
 51
 52
 53
 54
 55
 56
 57
 58
 59
 60
 61
 62
 63
 64
 65
 66
 67
 68
 69
 70
 71
 72
 73
 74
 75
 76
 77
 78
 79
 80
 81
 82
 83
 84
 85
 86
 87
 88
 89
 90
 91
 92
 93
 94
 95
 96
 97
 98
 99
 100
 101
 102
 103
 104
 105
 106
 107
 108
 109
 110
 111
 112
 113
 114
 115
 116
 117
 118
 119
 120
 121
 122
 123
 124
 125
 126
 127
 128
 129
 130
 131
 132
 133
 134
 135
 136
 137
 138
 139
 140
 141
 142
 143
 144
 145
 146
 147
 148
 149
 150
 151
 152
 153
 154
 155
 156
 157
 158
 159
 160
 161
 162
 163
 164
 165
 166
 167
 168
 169
 170
 171
 172
 173
 174
 175
 176
 177
 178
 179
 180
 181
 182
 183
 184
 185
 186
 187
 188
 189
 190
 191
 192
 193
 194
 195
 196
 197
 198
 199
 200
 201
 202
 203
 204
 205
 206
 207
 208
 209
 210
 211
 212
 213
 214
 215
 216
 217
 218
 219
 220
 221
 222
 223
 224
 225
 226
 227
 228
 229
 230
 231
 232
 233
 234
 235
 236
 237
 238
 239
 240
 241
 242
 243
 244
 245
 246
 247
 248
 249
 250
 251
 252
 253
 254
 255
 256
 257
 258
 259
 260
 261
 262
 263
 264
 265
 266
 267
 268
 269
 270
 271
 272
 273
 274
 275
 276
 277
 278
 279
 280
 281
 282
 283
 284
 285
 286
 287
 288
 289
 290
 291
 292
 293
 294
 295
 296
 297
 298
 299
 300
 301
 302
 303
 304
 305
 306
 307
 308
 309
 310
 311
 312
 313
 314
 315
 316
 317
 318
 319
 320
 321
 322
 323
 324
 325
 326
 327
 328
 329
 330
 331
 332
 333
 334
 335
 336
 337
 338
 339
 340
 341
 342
 343
 344
 345
 346
 347
 348
 349
 350
 351
 352
 353
 354
 355
 356
 357
 358
 359
 360
 361
 362
 363
 364
 365
 366
 367
 368
 369
 370
 371
 372
 373
 374
 375
 376
 377
 378
 379
 380
 381
 382
 383
 384
 385
 386
 387
 388
 389
 390
 391
 392
 393
 394
 395
 396
 397
 398
 399
 400
 401
 402
 403
 404
 405
 406
 407
 408
 409
 410
 411
 412
 413
 414
 415
 416
 417
 418
 419
 420
 421
 422
 423
 424
 425
 426
 427
 428
 429
 430
 431
 432
 433
 434
 435
 436
 437
 438
 439
 440
 441
 442
 443
 444
 445
 446
 447
 448
 449
 450
 451
 452
 453
 454
 455
 456
 457
 458
 459
 460
 461
 462
 463
 464
 465
 466
 467
 468
 469
 470
 471
 472
 473
 474
 475
 476
 477
 478
 479
 480
 481
 482
 483
 484
 485
 486
 487
 488
 489
 490
 491
 492
 493
 494
 495
 496
 497
 498
 499
 500
 501
 502
 503
 504
 505
 506
 507
 508
 509
 510
 511
 512
 513
 514
 515
 516
 517
 518
 519
 520
 521
 522
 523
 524
 525

[illegible]

• • • • •

1	4
2	1
3	0
4	1
5	2
6	3
7	4
8	5
9	6
10	7
11	8
12	9
13	0
14	1
15	2
16	3
17	4
18	5
19	6
20	7
21	8
22	9
23	0
24	1
25	2
26	3
27	4
28	5
29	6
30	7
31	8
32	9
33	0
34	1
35	2
36	3
37	4
38	5
39	6
40	7
41	8
42	9
43	0
44	1
45	2
46	3
47	4
48	5
49	6
50	7
51	8
52	9
53	0
54	1
55	2
56	3
57	4
58	5
59	6
60	7
61	8
62	9
63	0
64	1
65	2
66	3
67	4
68	5
69	6
70	7
71	8
72	9
73	0
74	1
75	2
76	3
77	4
78	5
79	6
80	7
81	8
82	9
83	0
84	1
85	2
86	3
87	4
88	5
89	6
90	7
91	8
92	9
93	0
94	1
95	2
96	3
97	4
98	5
99	6
100	7
101	8
102	9
103	0
104	1
105	2
106	3
107	4
108	5
109	6
110	7
111	8
112	9
113	0
114	1
115	2
116	3
117	4
118	5
119	6
120	7
121	8
122	9
123	0
124	1
125	2
126	3
127	4
128	5
129	6
130	7
131	8
132	9
133	0
134	1
135	2
136	3
137	4
138	5
139	6
140	7
141	8
142	9
143	0
144	1
145	2
146	3
147	4
148	5
149	6
150	7
151	8
152	9
153	0
154	1
155	2
156	3
157	4
158	5
159	6
160	7
161	8
162	9
163	0
164	1
165	2
166	3
167	4
168	5
169	6
170	7
171	8
172	9
173	0
174	1
175	2
176	3
177	4
178	5
179	6
180	7
181	8
182	9
183	

1.01	13.30	27	0.04	0.	0.09	0.	1.03	5.00	102	0.	0.	0.	10.
1.01	14.00	28	0.09	6.	0.09	0.	1.03	3.30	103	0.	0.	0.	9.
1.01	14.30	29	0.11	0.	0.11	0.	1.03	4.00	104	0.	0.	0.	9.
1.01	15.00	30	0.11	0.	0.11	0.	1.03	4.30	105	0.	0.	0.	9.
1.01	15.30	31	0.13	0.	0.13	0.	1.03	5.00	106	0.	0.	0.	8.
1.01	16.00	32	0.42	0.23	0.14	3.	1.03	5.30	107	0.	0.	0.	8.
1.01	16.30	33	0.10	0.05	0.05	7.	1.03	6.00	108	0.	0.	0.	8.
1.01	17.00	34	0.10	0.05	0.05	7.	1.03	6.30	109	0.	0.	0.	7.
1.01	17.30	35	0.08	0.03	0.05	5.	1.03	7.00	110	0.	0.	0.	7.
1.01	18.00	36	0.08	0.03	0.05	4.	1.03	7.30	111	0.	0.	0.	7.
1.01	18.30	37	0.01	0.	0.01	3.	1.03	8.00	112	0.	0.	0.	6.
1.01	19.00	38	0.01	0.	0.01	2.	1.03	8.30	113	0.	0.	0.	6.
1.01	19.30	39	0.01	0.	0.01	1.	1.03	9.00	114	0.	0.	0.	6.
1.01	20.00	40	0.01	0.	0.01	1.	1.03	9.30	115	0.	0.	0.	6.
1.01	20.30	41	0.01	0.	0.01	1.	1.03	10.00	116	0.	0.	0.	6.
1.01	21.00	42	0.01	0.	0.01	1.	1.03	10.30	117	0.	0.	0.	5.
1.01	21.30	43	0.01	0.	0.01	1.	1.03	11.00	118	0.	0.	0.	5.
1.01	22.00	44	0.01	0.	0.01	1.	1.03	11.30	119	0.	0.	0.	5.
1.01	22.30	45	0.01	0.	0.01	1.	1.03	12.00	120	0.	0.	0.	5.
1.01	23.00	46	0.01	0.	0.01	1.	1.03	12.30	121	0.	0.	0.	5.
1.01	23.30	47	0.01	0.	0.01	1.	1.03	13.00	122	0.	0.	0.	4.
1.02	0.	48	0.01	0.	0.01	0.	1.03	13.30	123	0.	0.	0.	4.
1.02	0.30	49	0.05	0.01	0.05	0.	1.03	14.00	124	0.	0.	0.	4.
1.02	1.00	50	0.05	0.00	0.05	0.	1.03	14.30	125	0.	0.	0.	4.
1.02	1.30	51	0.05	0.00	0.05	0.	1.03	15.00	126	0.	0.	0.	4.
1.02	2.00	52	0.05	0.00	0.05	0.	1.03	15.30	127	0.	0.	0.	4.
1.02	2.30	53	0.05	0.00	0.05	0.	1.03	16.00	128	0.	0.	0.	3.
1.02	3.00	54	0.05	0.00	0.05	0.	1.03	16.30	129	0.	0.	0.	3.
1.02	3.30	55	0.05	0.01	0.05	0.	1.03	17.00	130	0.	0.	0.	3.
1.02	4.00	56	0.05	0.00	0.05	0.	1.03	17.30	131	0.	0.	0.	3.
1.02	4.30	57	0.05	0.00	0.05	0.	1.03	18.00	132	0.	0.	0.	3.
1.02	5.00	58	0.05	0.00	0.05	0.	1.03	18.30	133	0.	0.	0.	3.
1.02	5.30	59	0.05	0.00	0.05	0.	1.03	19.00	134	0.	0.	0.	3.
1.02	6.00	60	0.05	0.00	0.05	0.	1.03	19.30	135	0.	0.	0.	3.
1.02	6.30	61	0.17	0.12	0.05	1.	1.03	20.00	136	0.	0.	0.	2.
1.02	7.00	62	0.17	0.12	0.05	4.	1.03	20.30	137	0.	0.	0.	2.
1.02	7.30	63	0.17	0.12	0.05	6.	1.03	21.00	138	0.	0.	0.	2.
1.02	8.00	64	0.17	0.12	0.05	7.	1.03	21.30	139	0.	0.	0.	2.
1.02	8.30	65	0.17	0.12	0.05	7.	1.03	22.00	140	0.	0.	0.	2.
1.02	9.00	66	0.17	0.12	0.05	8.	1.03	22.30	141	0.	0.	0.	2.
1.02	9.30	67	0.17	0.12	0.05	8.	1.03	23.00	142	0.	0.	0.	2.
1.02	10.00	68	0.17	0.12	0.05	8.	1.03	23.30	143	0.	0.	0.	2.
1.02	10.30	69	0.17	0.12	0.05	8.	1.04	0.	144	0.	0.	0.	2.
1.02	11.00	70	0.17	0.12	0.05	8.	1.04	0.30	145	0.	0.	0.	2.
1.02	11.30	71	0.17	0.12	0.05	8.	1.04	1.00	146	0.	0.	0.	2.
1.02	12.00	72	0.17	0.12	0.05	8.	1.04	1.30	147	0.	0.	0.	2.
1.02	12.30	73	0.95	0.90	0.05	15.	1.04	2.00	148	0.	0.	0.	2.
1.02	13.00	74	0.95	0.90	0.05	31.	1.04	2.30	149	0.	0.	0.	1.
1.02	13.30	75	1.14	1.03	0.05	47.	1.04	3.00	150	0.	0.	0.	1.

SUM 24.31 20.63 3.68 1728.
(617.9) (524.3) (92.3) (48.53)

PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL VOLUME
178.	93.	32.	12.	1723.
5.	5.	1.	0.	49.
	17.30	23.66	26.65	26.71
	439.45	601.03	676.84	678.56
	45.	63.	71.	71.
	57.	78.	88.	88.

CFS
INCHES
MM
AC-FT
THOUS CU M

626.1	626.2	626.3	626.4	626.5	626.6	626.7	626.8	626.9	627.0	627.1	627.2	627.3	627.4	627.5	627.6	627.7	627.8	627.9	628.0	628.1	628.2	628.3	628.4	628.5	628.6	628.7	628.8	628.9	629.0	629.1	629.2	629.3	629.4	629.5	629.6	629.7	629.8	629.9	630.0	630.1	630.2	630.3	630.4	630.5	630.6	630.7	630.8	630.9	631.0	631.1	631.2	631.3	631.4	631.5	631.6	631.7	631.8	631.9	632.0	632.1	632.2	632.3	632.4	632.5	632.6	632.7	632.8	632.9	633.0	633.1	633.2	633.3	633.4	633.5	633.6	633.7	633.8	633.9	634.0	634.1	634.2	634.3	634.4	634.5	634.6	634.7	634.8	634.9	635.0	635.1	635.2	635.3	635.4	635.5	635.6	635.7	635.8	635.9	636.0	636.1	636.2	636.3	636.4	636.5	636.6	636.7	636.8	636.9	637.0	637.1	637.2	637.3	637.4	637.5	637.6	637.7	637.8	637.9	638.0	638.1	638.2	638.3	638.4	638.5	638.6	638.7	638.8	638.9	639.0	639.1	639.2	639.3	639.4	639.5	639.6	639.7	639.8	639.9	640.0	640.1	640.2	640.3	640.4	640.5	640.6	640.7	640.8	640.9	641.0	641.1	641.2	641.3	641.4	641.5	641.6	641.7	641.8	641.9	642.0	642.1	642.2	642.3	642.4	642.5	642.6	642.7	642.8	642.9	643.0	643.1	643.2	643.3	643.4	643.5	643.6	643.7	643.8	643.9	644.0	644.1	644.2	644.3	644.4	644.5	644.6	644.7	644.8	644.9	645.0	645.1	645.2	645.3	645.4	645.5	645.6	645.7	645.8	645.9	646.0	646.1	646.2	646.3	646.4	646.5	646.6	646.7	646.8	646.9	647.0	647.1	647.2	647.3	647.4	647.5	647.6	647.7	647.8	647.9	648.0	648.1	648.2	648.3	648.4	648.5	648.6	648.7	648.8	648.9	649.0	649.1	649.2	649.3	649.4	649.5	649.6	649.7	649.8	649.9	650.0	650.1	650.2	650.3	650.4	650.5	650.6	650.7	650.8	650.9	651.0	651.1	651.2	651.3	651.4	651.5	651.6	651.7	651.8	651.9	652.0	652.1	652.2	652.3	652.4	652.5	652.6	652.7	652.8	652.9	653.0	653.1	653.2	653.3	653.4	653.5	653.6	653.7	653.8	653.9	654.0	654.1	654.2	654.3	654.4	654.5	654.6	654.7	654.8	654.9	655.0	655.1	655.2	655.3	655.4	655.5	655.6	655.7	655.8	655.9	656.0	656.1	656.2	656.3	656.4	656.5	656.6	656.7	656.8	656.9	657.0	657.1	657.2	657.3	657.4	657.5	657.6	657.7	657.8	657.9	658.0	658.1	658.2	658.3	658.4	658.5	658.6	658.7	658.8	658.9	659.0	659.1	659.2	659.3	659.4	659.5	659.6	659.7	659.8	659.9	660.0	660.1	660.2	660.3	660.4	660.5	660.6	660.7	660.8	660.9	661.0	661.1	661.2	661.3	661.4	661.5	661.6	661.7	661.8	661.9	662.0	662.1	662.2	662.3	662.4	662.5	662.6	662.7	662.8	662.9	663.0	663.1	663.2	663.3	663.4	663.5	663.6	663.7	663.8	663.9	664.0	664.1	664.2	664.3	664.4	664.5	664.6	664.7	664.8	664.9	665.0	665.1	665.2	665.3	665.4	665.5	665.6	665.7	665.8	665.9	666.0	666.1	666.2	666.3	666.4	666.5	666.6	666.7	666.8	666.9</
-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	-------	---------

382. AT TIME 43.00 HOURS

CFS
CMS
INCHES
MM
AC-FT
THOUS CL M

PEAK	6-HOUR	24-HOUR	72-HOUR	TOTAL	VOLUME
382.	241.	127.	46.		6643.
11.	8.	4.	1.		188.
	3.52	6.14	6.59		6.69
	89.28	155.97	165.84		159.87
	144.	252.	274.		275.
	178.	311.	339.		339.

STATION LOWDAM, PLAN 1, RATIO 3
END-3F-PERIOD HYDROGRAPH ORDINATES[illegible][illegible]

[illegible]

PEAK OUTFLOW IS 606. AT TIME 42.50 HOURS

CF5	25AK	6-HOUR	72-HOUR	TOTAL	VOLUME
CMS	505.	469.	199.	72.	10379.
CMS	17.	15.	6.	2.	234.
INCHES		5.56	9.64	10.45	10.45
MM		143.83	244.81	265.35	265.40
AC-FT		232.	396.	429.	429.
THOUS CU M		287.	488.	529.	529.

STATION LONDON, PLAN 1, RATIO 4

END-OF-PERIOD HYDROGRAPH ORDINATES

[illegible][illegible]

PEAK FLOW AND STORAGE (END OF PERIOD) SUMMARY FORMULTEPLE PLAN-RATIO ECONOMIC COMPUTATIONS
 FLOWS IN CUBIC FEET PER SECOND (CUBIC METERS PER SECOND)
 AREA IN SQUARE MILES (SQUARE KILOMETERS)

OPERATION	STATION	AREA	PLAN	RATIOS APPLIED TO FLOWS			
				RATIO 1	RATIO 2	RATIO 3	RATIO 4
				0.31	0.32	0.50	1.00
HYDROGRAPH AT	1	0.72 (0.23E 18)	1	358. (10.13)(369. 10.46)(577. 16.34)(1154. 32.69)(
ROUTED TO	UPDAM	0.72 (0.12E 25)	1	352. (9.97)(366. 10.35)(574. 16.26)(1152. 32.63)(
HYDROGRAPH AT	2	0.05 (0.42E 18)	1	55. (1.56)(57. 1.62)(85. 2.52)(178. 5.05)(
2 COMBINED	COMB	0.77 (0.00)	1	373. (10.57)(388. 10.97)(605. 17.23)(1221. 34.58)(
ROUTED TO	LOWDAM	0.77 (0.12E 25)	1	354. (10.32)(382. 10.82)(606. 17.15)(1225. 34.68)(

Cold Spring Upper Dam NY 106

SUMMARY OF DAM SAFETY ANALYSIS

PLAN 1

ELEVATION
STORAGE
OUTFLOW

INITIAL VALUE
647.00
61.
0.

SPILLWAY CREST
547.00
61.
0.

TOP OF DAM
647.40
82.
247.

RATIO
OF
PMF
0.31
0.32
0.50
1.00

MAXIMUM
RESERVOIR
W.S.-ELEV
645.63
649.65
649.94
650.52

MAXIMUM
DEPTH
OVER DAM
0.23
0.25
0.54
1.12

MAXIMUM
STORAGE
AC-FT
91.
91.
95.
101.

MAXIMUM
OUTFLOW
CFS
352.
366.
574.
1152.

DURATION
OVER TOP
HOURS
3.50
5.50
5.50
10.50

TIME OF
MAX OUTFLOW
HOURS
43.00
42.50
42.50
42.50

TIME OF
FAILURE
HOURS
0.
0.
0.
0.

COLD SPRING DAM (Lower) NY107

SUMMARY OF DAM SAFETY ANALYSIS


PLAN 1

RATIO OF PMF	MAXIMUM RESERVOIR W.S.-ELEV	ELEVATION STORAGE OUTFLOW	INITIAL VALUE	SPILLWAY CREST	TOP OF DAM	MAXIMUM STORAGE AC-FT	MAXIMUM OUTFLOW CFS	DURATION OVER TOP HOURS	TIME OF MAX CUIFLOW HOURS	TIME OF FAILURE HOURS
0.31	628.50		628.00	626.00	628.50	70.	364.	0.	43.00	6.
0.32	628.54		54.	54.	70.	70.	382.	0.50	43.00	0.
0.50	628.84		0.	0.	72.	72.	606.	4.50	42.50	0.
1.00	629.37				76.	76.	1225.	9.00	42.50	0.

APPENDIX D
STABILITY COMPUTATIONS

COLD SPRING LOWER RESERVOIR DAM

SCALE 1"=5'

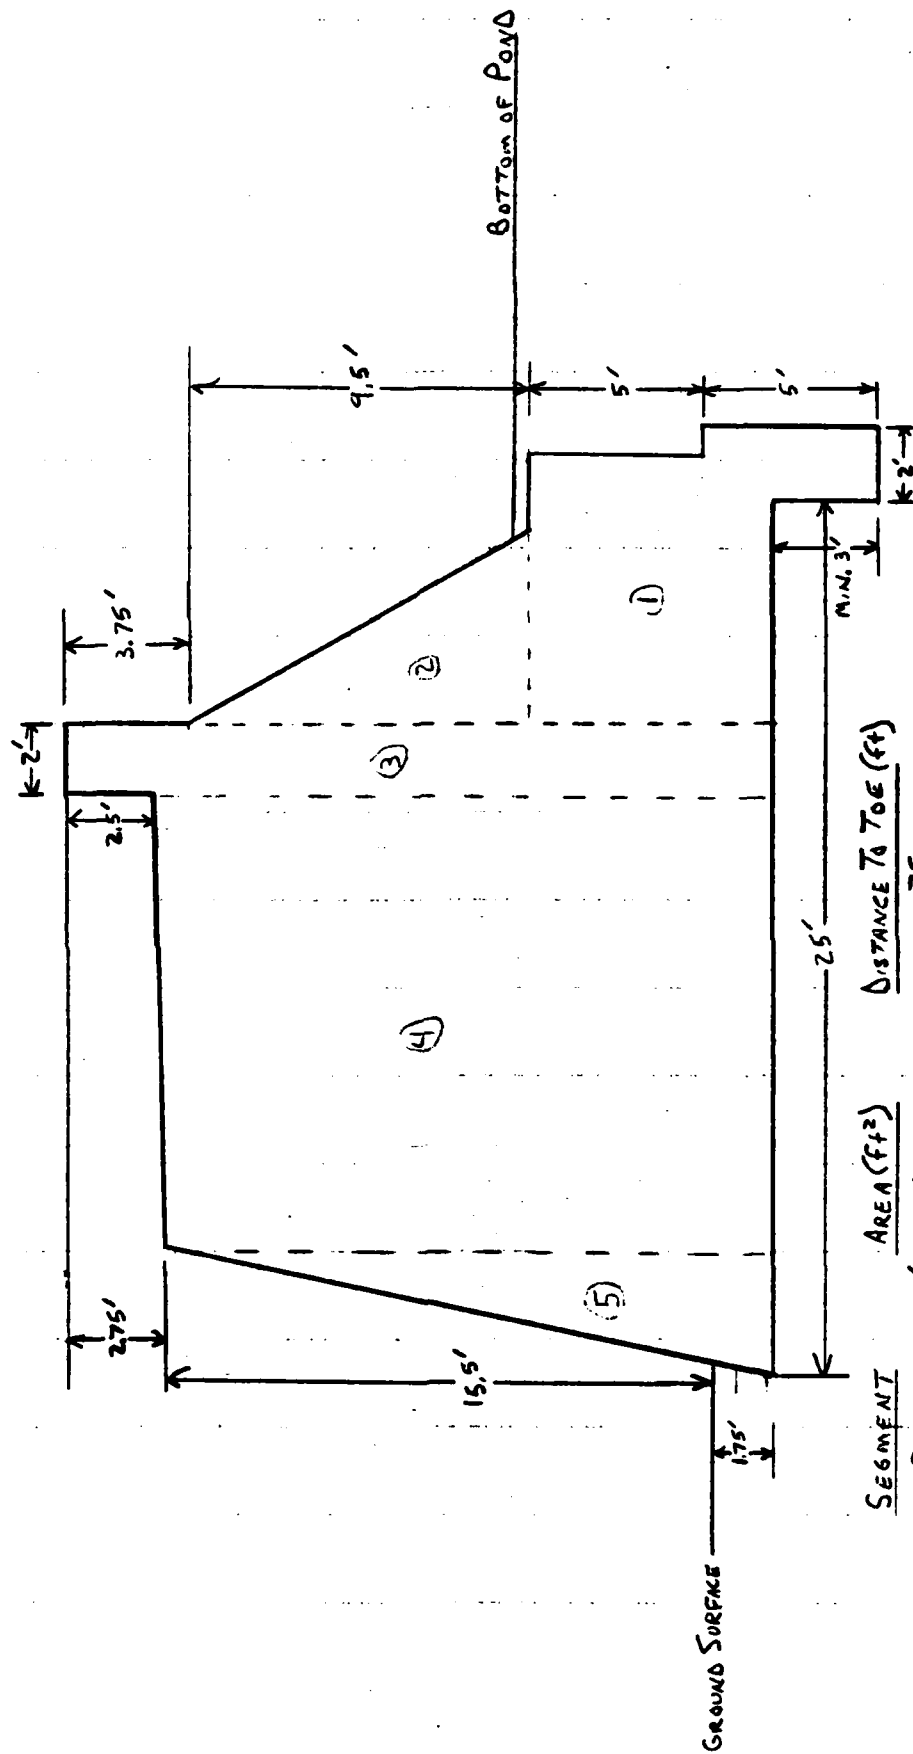

SEGMENT	AREA (FF ²)	DISTANCE TO TOE (FF)
①	$(7)(8.5) = 59.5$	22.75
②	$\frac{1}{2}(9.5)(5.5) = 26.1$	20.33
③	$(20.0)(2) = 40.0$	17.5
④	$(17.5)(13) = 227.5$	10
⑤	$\frac{1}{2}(17.25)(3.5) = 30.2$	2.33

STRUCTURAL STABILITY ANALYSIS

Analysis was based on cross section shown on plans with minor modifications based on measurements made at time of the inspection. The cross section used is shown on the following page. A normal analysis was performed, including an overturning analysis, since the dam has a composite cross section consisting of both concrete and laid-up stone. Due to unknown foundation conditions, full uplift pressure was assumed at the upstream toe, decreasing to tail-water pressure at the downstream toe.

ANALYSIS CONDITIONS

1. Normal conditions, water surface at spillway crest.
2. Same as #1 plus ice load of 5,000 pounds per linear foot.
3. $\frac{1}{2}$ PMF Flow - water surface 0.34 feet above the top of the dam.
4. PMF Flow - water surface 0.87 feet above the top of the dam.
5. Normal conditions with seismic coefficient of 0.1.

COLD SPRING DAM (LOWER)

STABILITY ANALYSIS PROGRAM - WORK SHEET

INPUT ENTRY

ANALYSIS CONDITION

		1	2	3	4	5
Unit Weight of Dam (K/ft ³)	0	0.15	0.15	0.15	0.15	0.15
Area of Segment No. 1 (ft ²)	1	59.5	59.5	59.5	59.5	59.5
Distance from Center of Gravity of Segment No. 1 to Downstream Toe (ft)	2	22.75	22.75	22.75	22.75	22.75
Area of Segment No. 2 (ft ²)	3	26.1	26.1	26.1	26.1	26.1
Distance from Center of Gravity of Segment No. 2 to Downstream Toe (ft)	4	20.33	20.33	20.33	20.33	20.33
Area of Segment No. 3 (ft ²)	5	40	40	40	40	40
Distance from Center of Gravity of Segment No. 3 to Downstream Toe (ft)	6	17.5	17.5	17.5	17.5	17.5
Base Width of Dam (Total) (ft)	7	27	27	27	27	27
Height of Dam (ft)	8	20	20	20	20	20
Ice Loading (K/L ft.)	9	—	5.0	—	—	—
Coefficient of Sliding	10	0.45	0.45	0.45	0.45	0.45
Unit Weight of Soil (K/ft ³) (deduct 18)	11	0.055	0.055	0.055	0.055	0.055
Active Soil Coefficient - Ka	12	0.33	0.33	0.33	0.33	0.33
Passive Soil Coefficient - Kp	13	3.0	3.0	3.0	3.0	3.0
Height of Water over Top of Dam or Spillway (ft)	14	0	0	2.84	3.37	0
Height of Soil for Active Pressure (ft)	15	7.0	7.0	7.0	7.0	7.0
Height of Soil for Passive Pressure (ft)	16	1.75	1.75	1.75	1.75	1.75
Height of Water in Tailrace Channel (ft)	17	1.75	1.75	5.0	5.0	1.75
Weight of Water (K/ft ³)	18	0.0624	0.0624	0.0624	0.0624	0.0624
Area of Segment No. 4 (ft ²)	19	227.5	227.5	227.5	227.5	227.5
Distance from Center of Gravity of Segment No. 4 to Downstream Toe (ft)	20	10	10	10	10	10
Height of Ice Load or Active Water (ft) (does not include 14)	46	17.5	17.5	17.5	17.5	17.5
Seismic Coefficient (g)	50	—	—	—	—	0.1
AREA OF SEGMENT 5	2	30.2	30.2	30.2	30.2	30.2
RESULTS OF ANALYSIS	22	2.33	2.33	2.33	2.33	2.33
Factor of Safety vs. Overturning		2.21	1.75	1.87	1.84	2.15
Distance From Toe to Resultant		9.79	7.67	8.96	8.79	9.60
Factor of Safety vs. Sliding		1.89	1.26	1.36	1.29	1.12

DIST. TO CENTER OF GRAV. SEG 5

APPENDIX E

REFERENCES

APPENDIX E


REFERENCES

- 1) U.S. Department of Commerce; Weather Bureau;
Hydrometeorological Report No. 33 - Seasonal Variation of the Probable Maximum Precipitation East of the 105th Meridian for Areas from 10 to 1,000 Square Miles and Durations of 6,12,24 and 48 Hours, April 1956.
- 2) H.W. King and E.F. Brater, Handbook of Hydraulics, 5th edition, McGraw-Hill, 1963.
- 3) University of the State of New York, Geology of New York, Education Leaflet 20, Reprinted 1973.
- 4) Elwyn E. Seelye, Design, 3rd edition, John Wiley and Sons, Inc., 1960.
- 5) U.S. Department of the Interior, Bureau of Reclamation ;
Design of Small Dams, 2nd edition (rev.reprint), 1977.
- 6) T.S. George and R.S. Taylor; Lower Hudson River Basin Hydrologic Flood Routing Model; Department of the Army, New York District Corps of Engineers; Water Resources Engineers, Inc. January, 1977.

APPENDIX F


DRAWINGS

DAM SITE

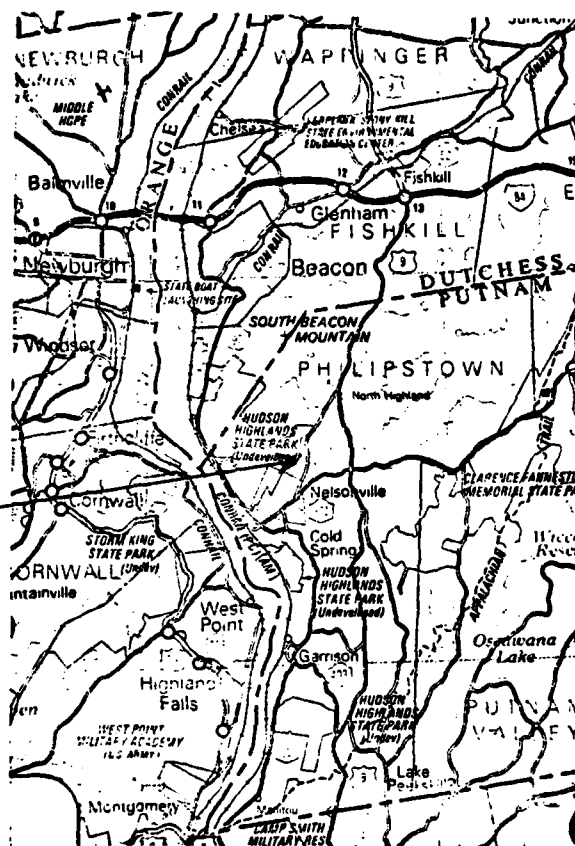

VICINITY MAP
COLD SPRING DAM (LOWER)


I.D.NO. NY-107

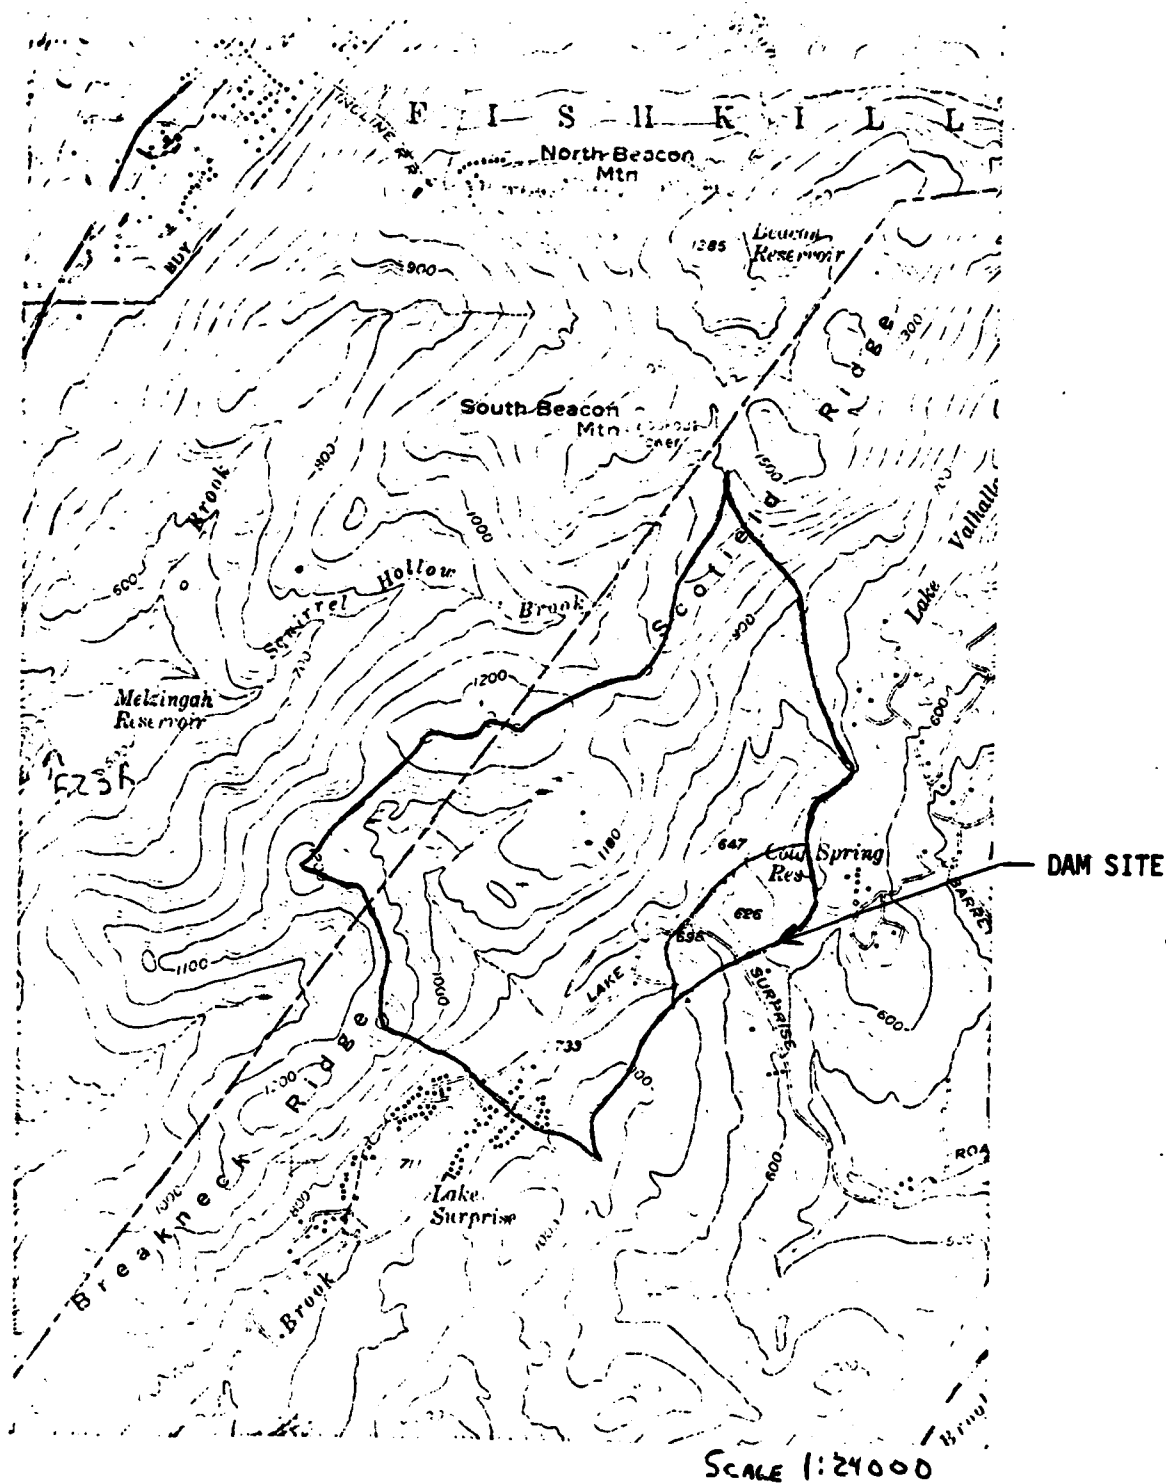

TOPOGRAPHIC MAP
COLD SPRING DAM (LOWER)

I.D. NO. NY-107

Allen Smith P.E. & L.S.
Cold Spring, N.Y.

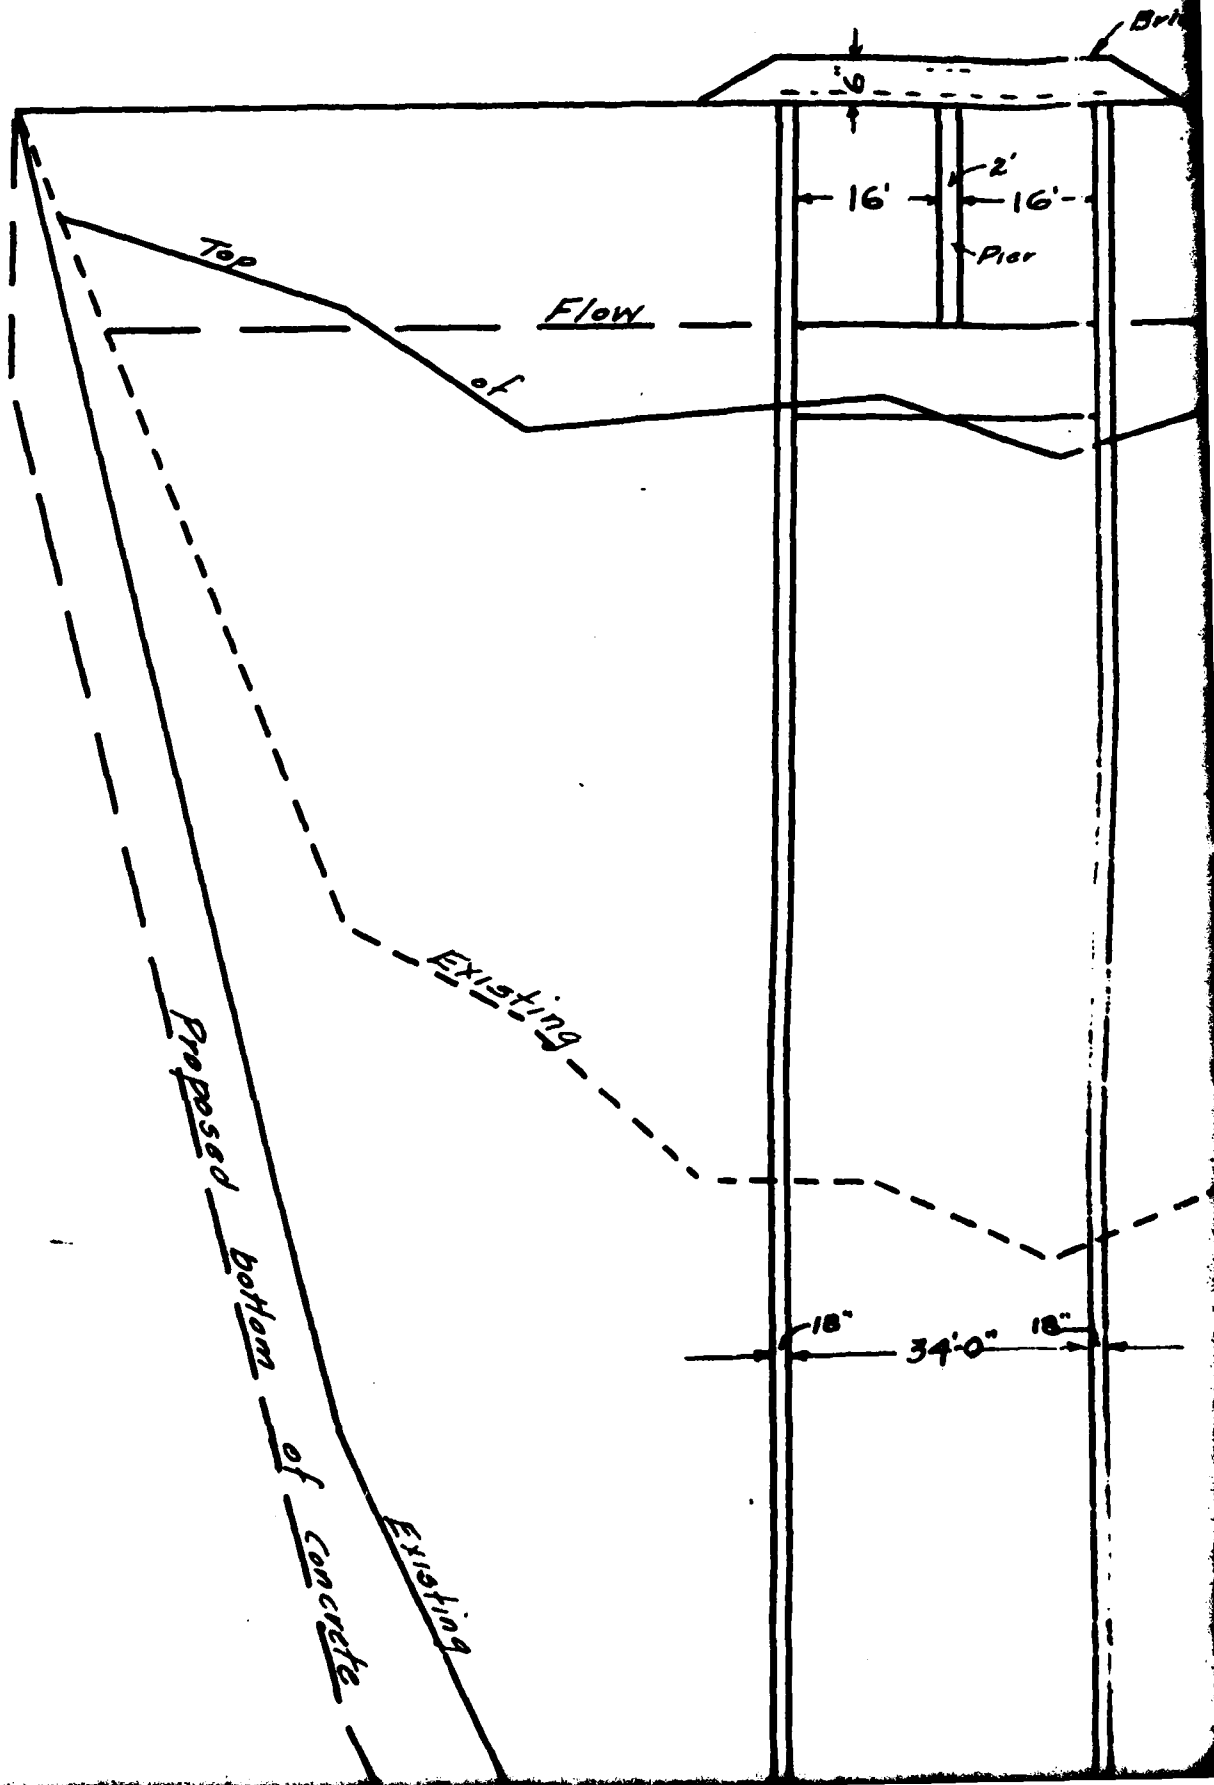

Bridge

Top of proposed concrete headwall El. 597

2'

16'

Pier

Line

Flow

Existing

rest



dam

face of

Bottom of pond at upstream


34'-0" 18"

downstream

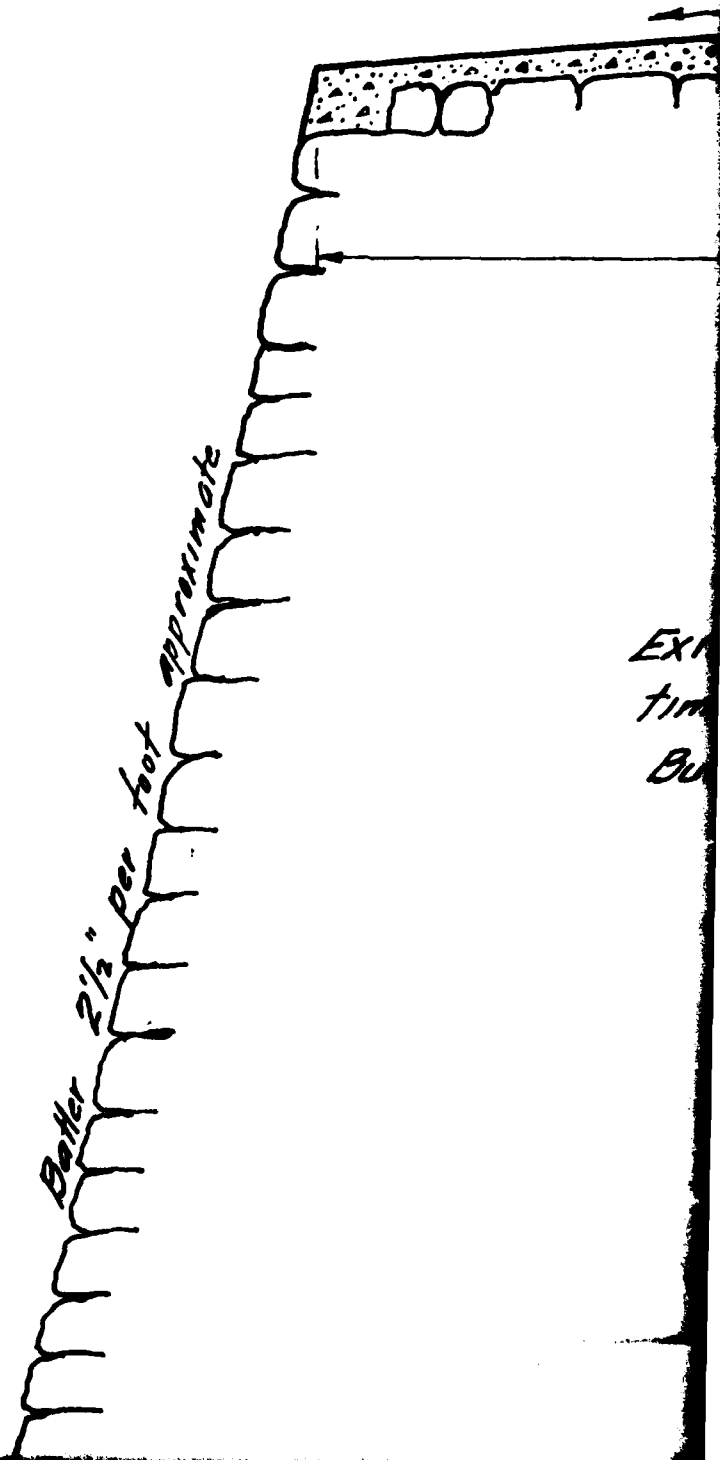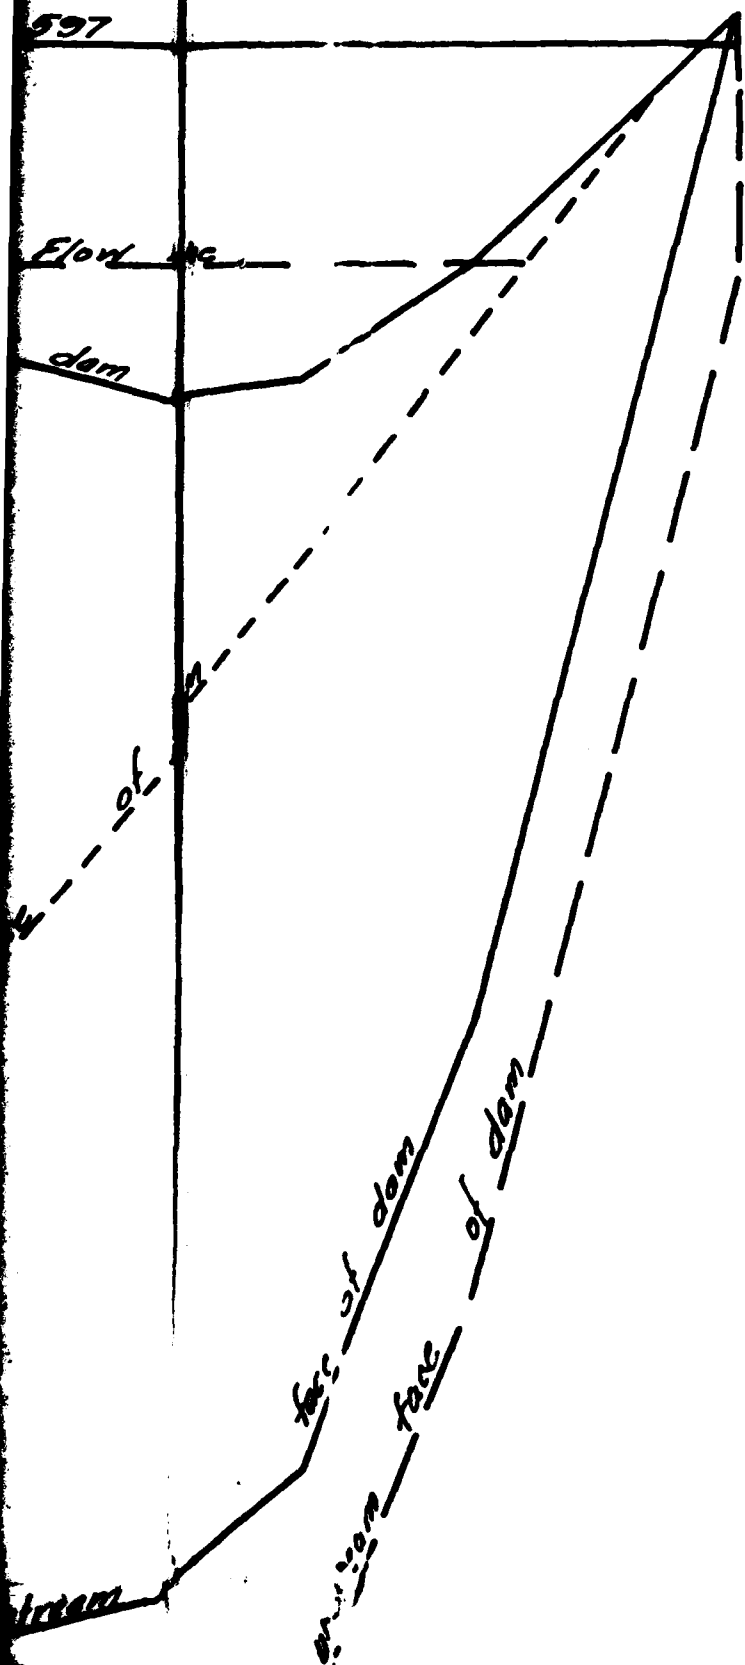


EX
tim
BU

4

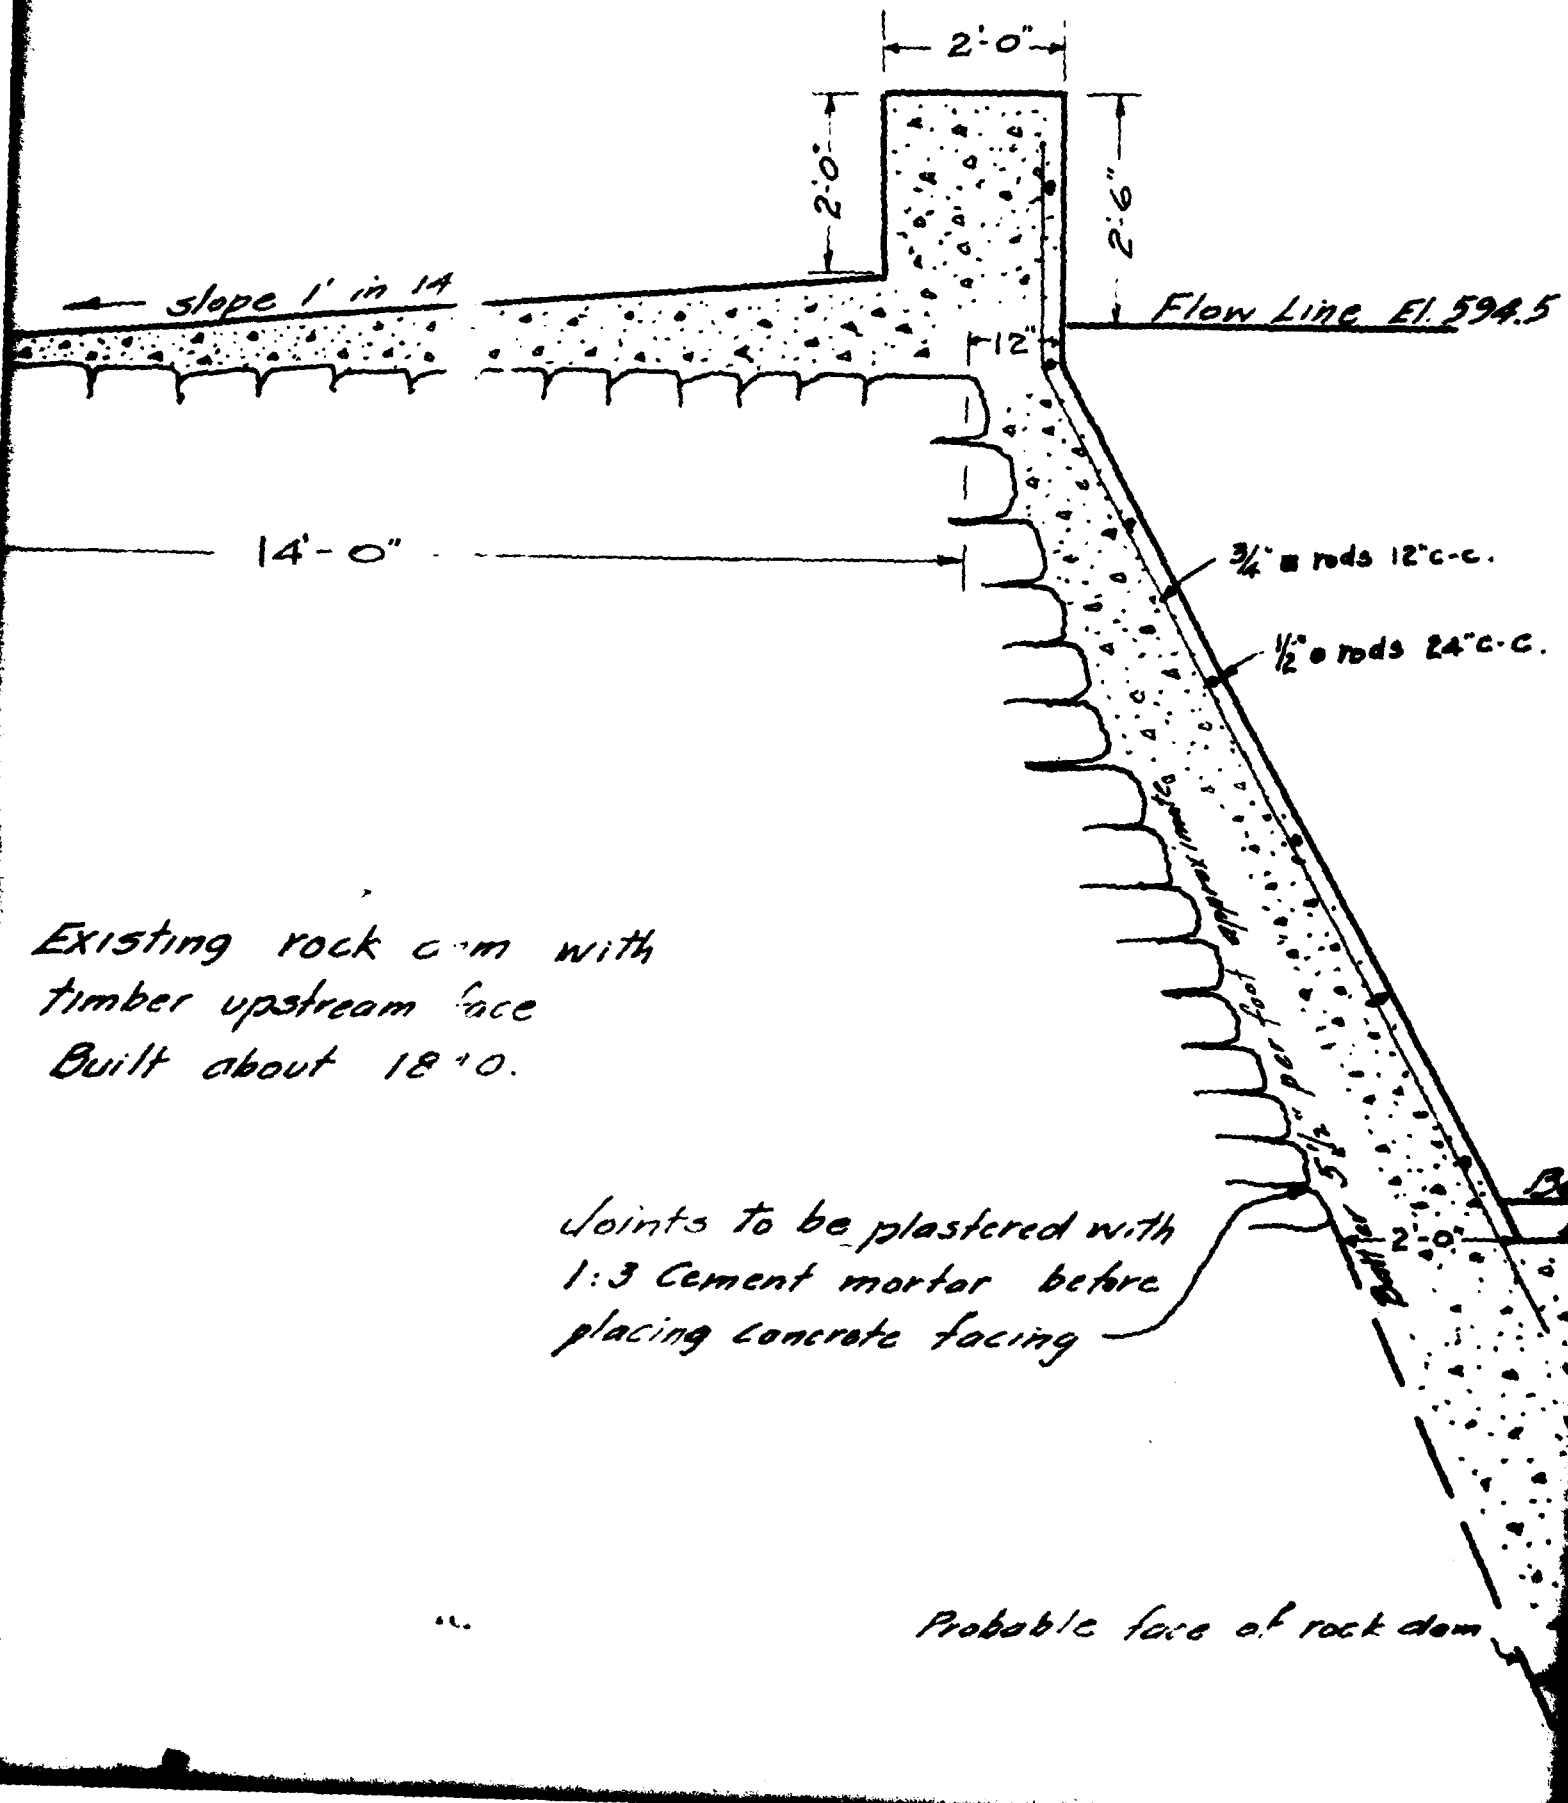

Existing rock dam with
timber upstream face
Built about 1810.

Joints to be plastered with
1:3 Cement mortar before
placing concrete facing

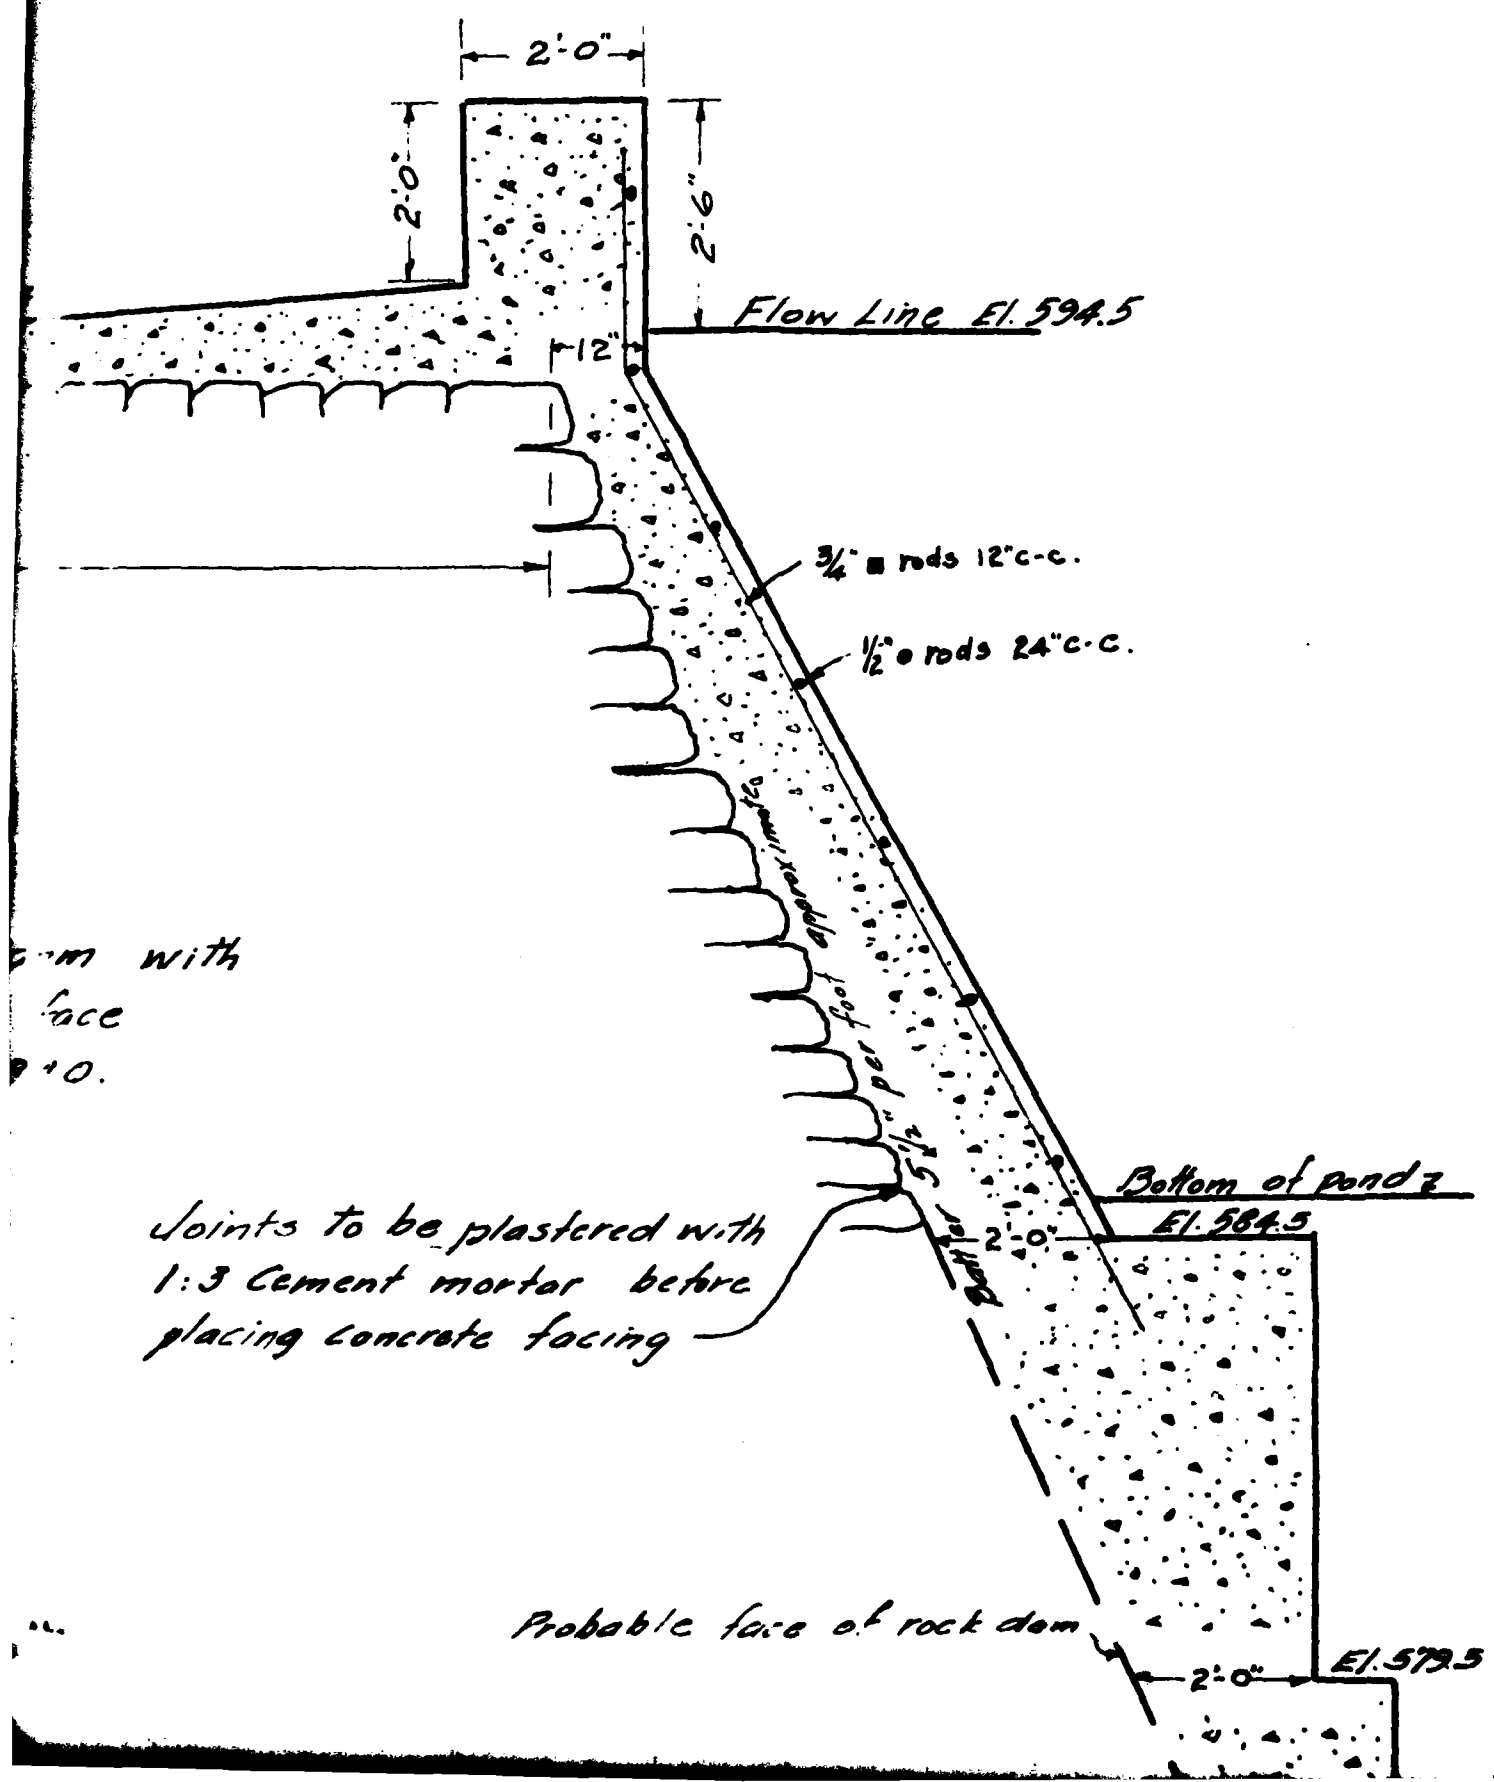


m with
face
10.

Joints to be plastered with
1:3 Cement mortar before
placing concrete facing

Probable face of rock dam

3

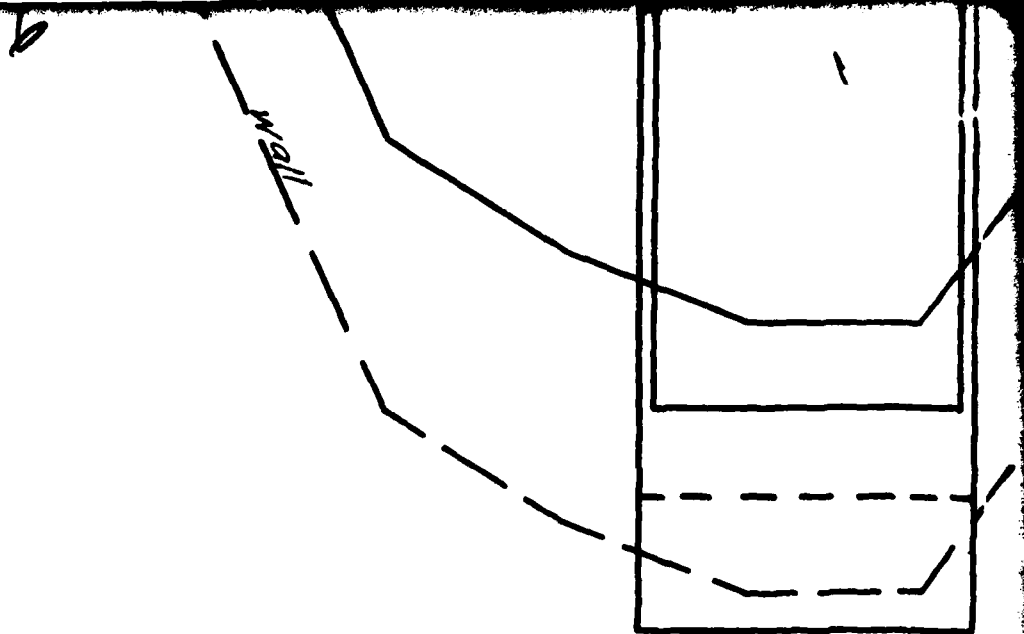

PROFILE

Scales { Hor. 1" = 2'
Vert. 1" = 2'


Concrete

1 part portland cement.

2 parts clean sharp sand.


4 parts broken stone.

Large stones to be used where
thickness of concrete more than 12"

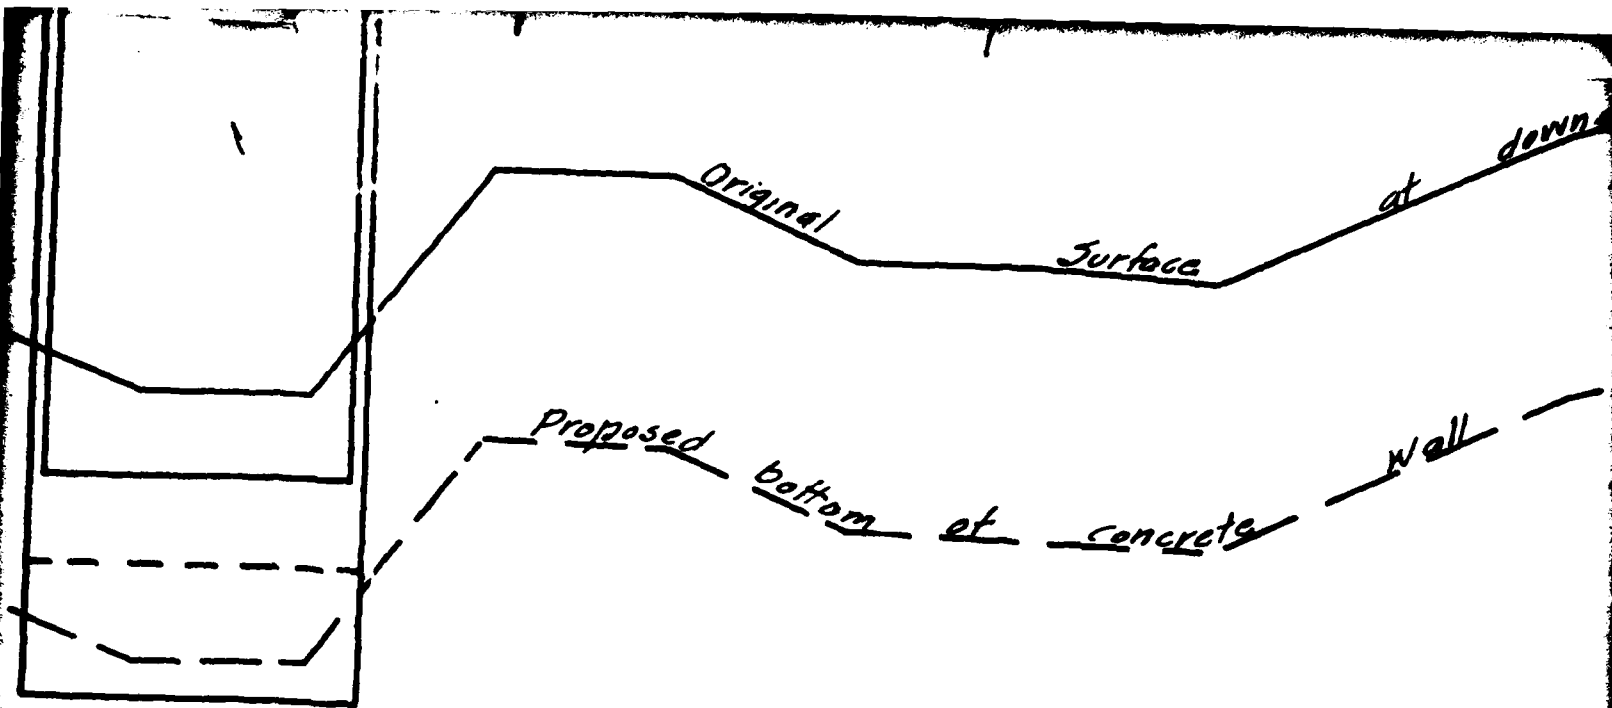



PROFILE

Scales { Hor. 1" = 20'
Vert. 1" = 2'

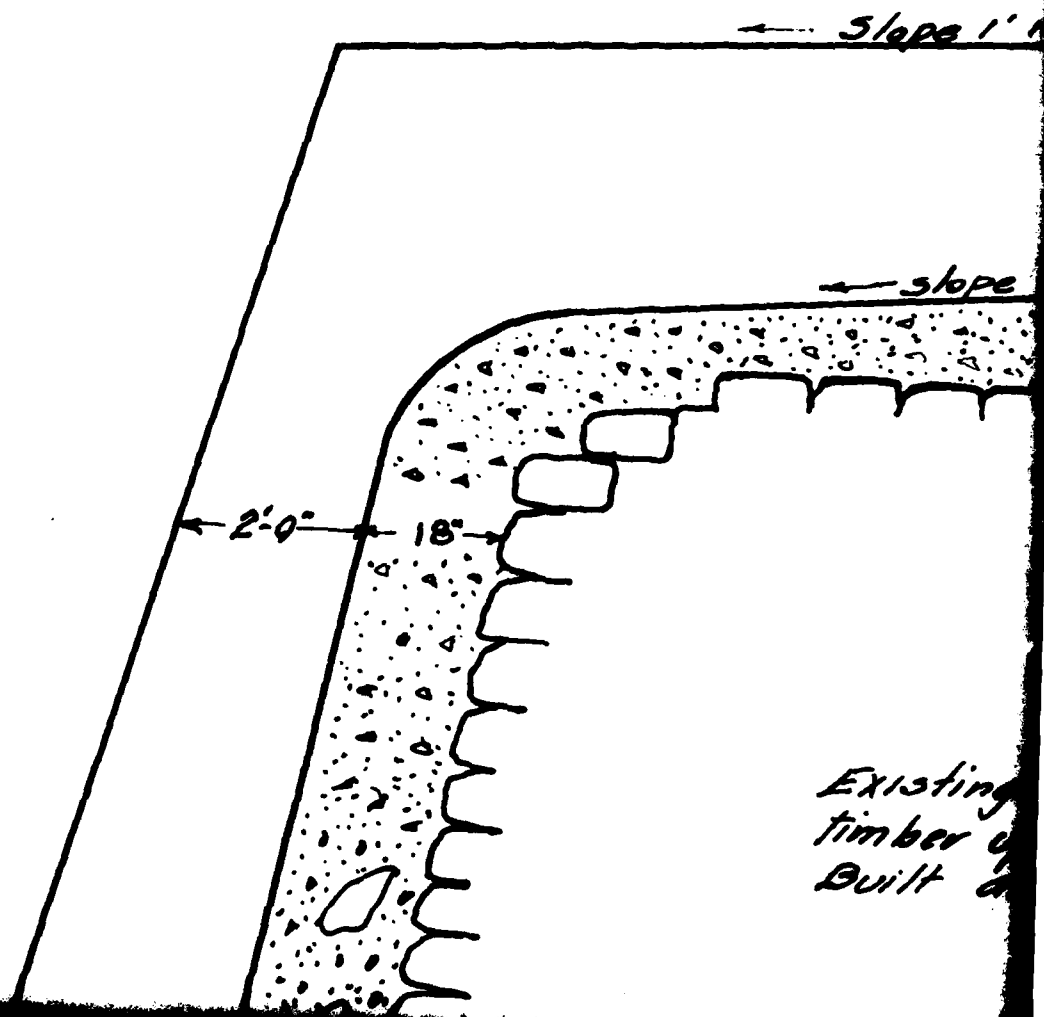

where
no than 12"



Existing
timber
Built

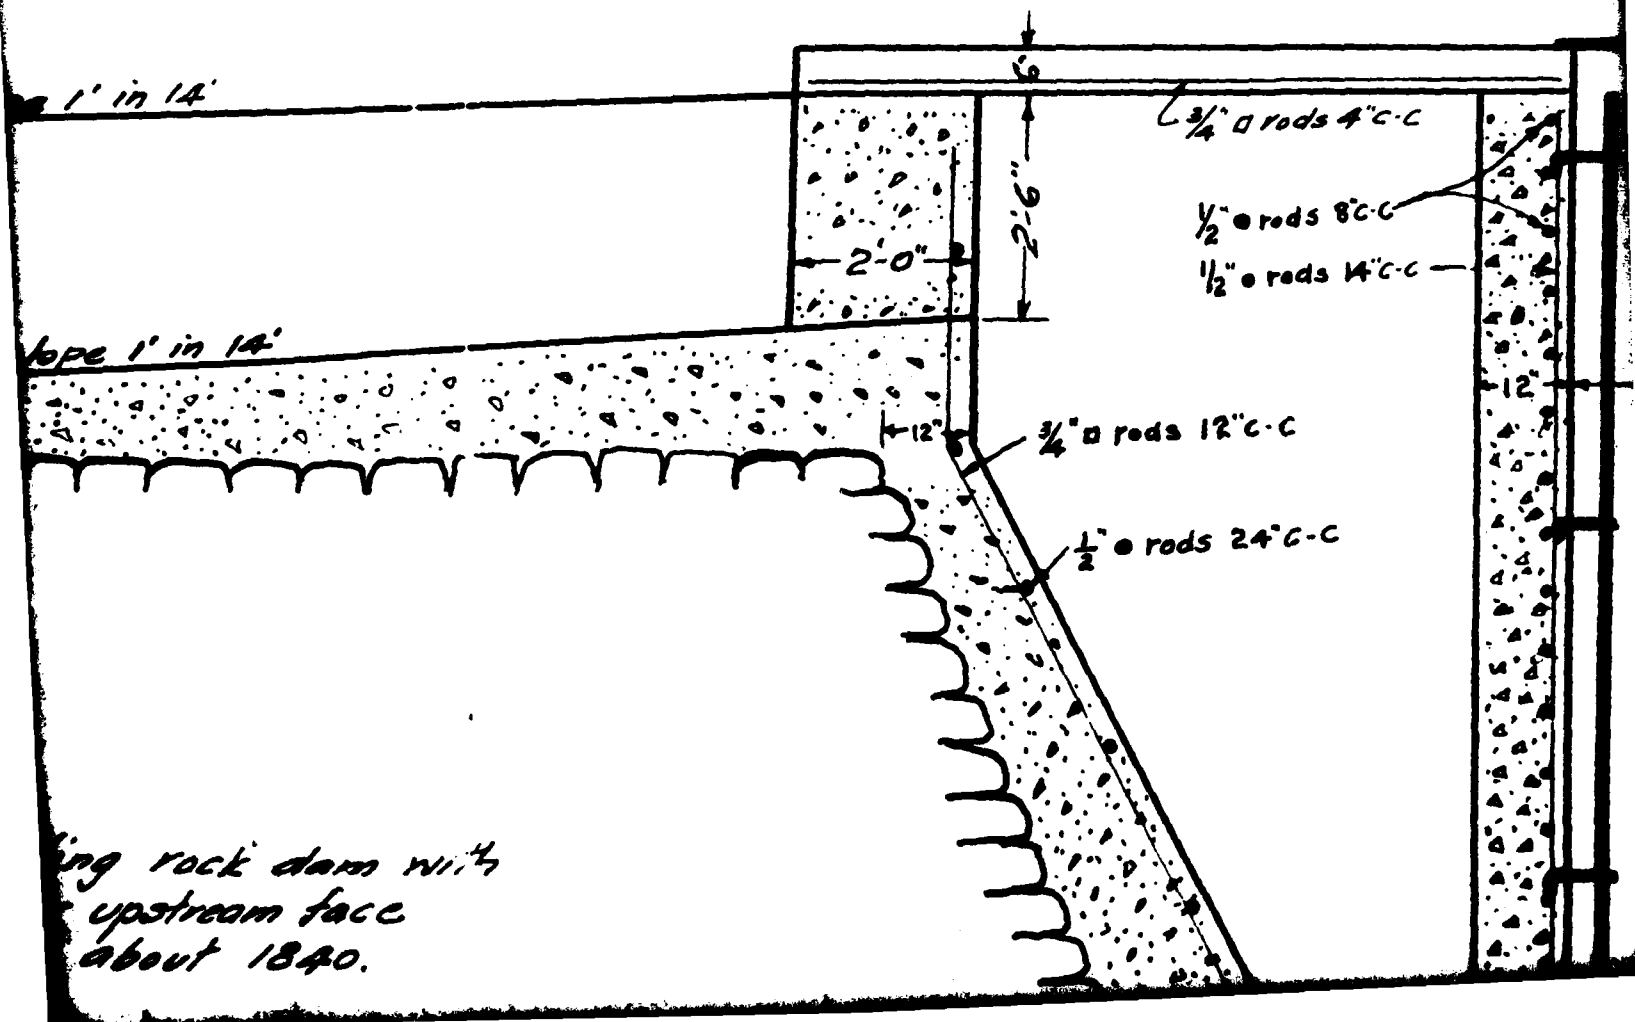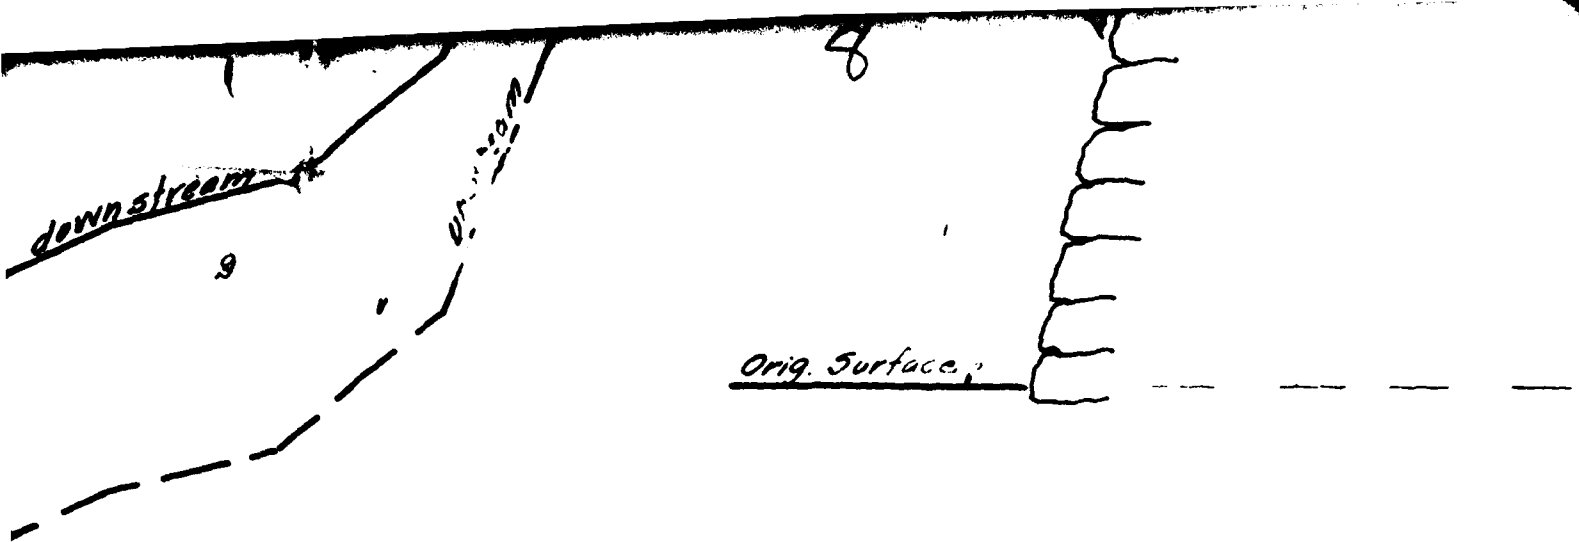

Probable face of rock

TYPICAL SECTION

Scale 1" = 2'

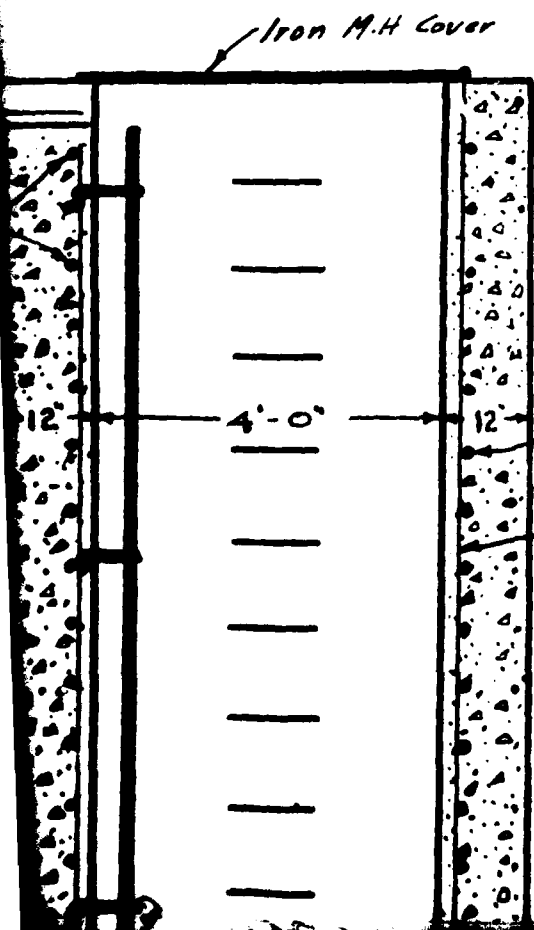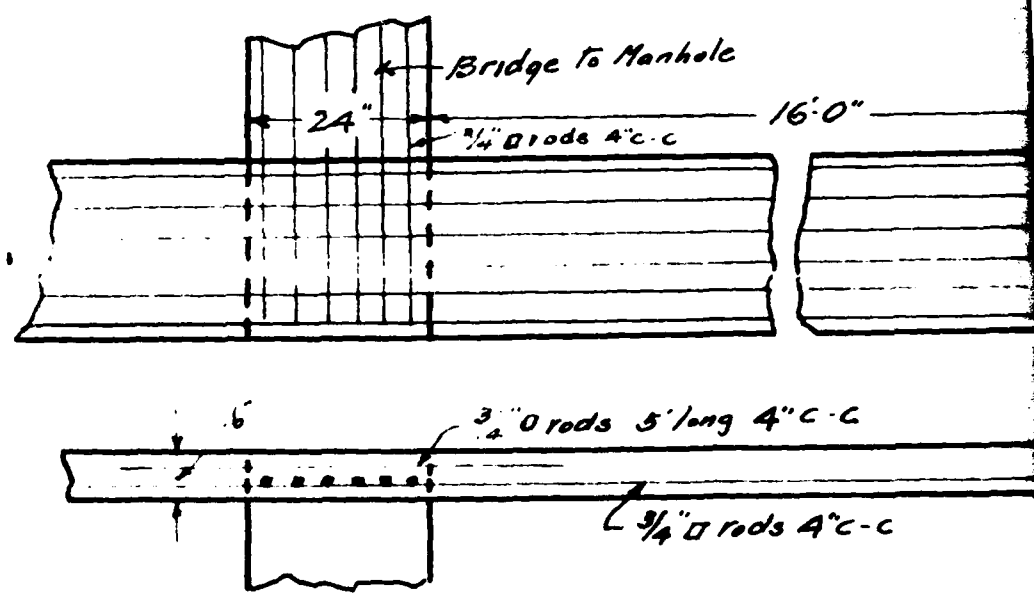

$\frac{1}{2}$ " rods 8" c-c
 $\frac{1}{2}$ " rods 14" c-c

BRIDGE AT SPILLWAY

Scale 1" = 2'

placing concrete facing

9

Probable face of rock dam


2'-0"

El. 579.5

Min. 3'-0"
To impervious strata

2'-0"

SECTION

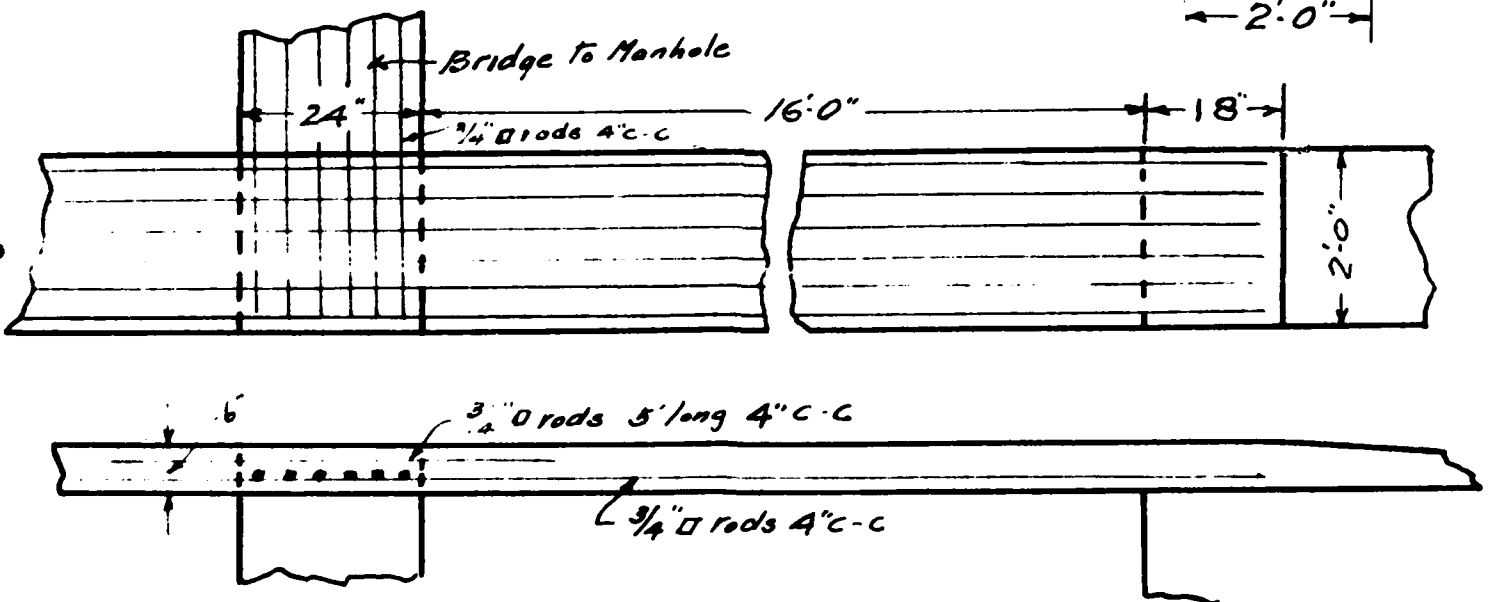

BRIDGE AT SPILLWAY

Scale 1" = 2'

1/2" rods 8" c-c

1/2" rods 14" c-c


Concrete

1 part portland cement.

2 parts clean sharp sand.

4 parts broken stone.

Large stones to be used where
thickness of concrete more than 12"

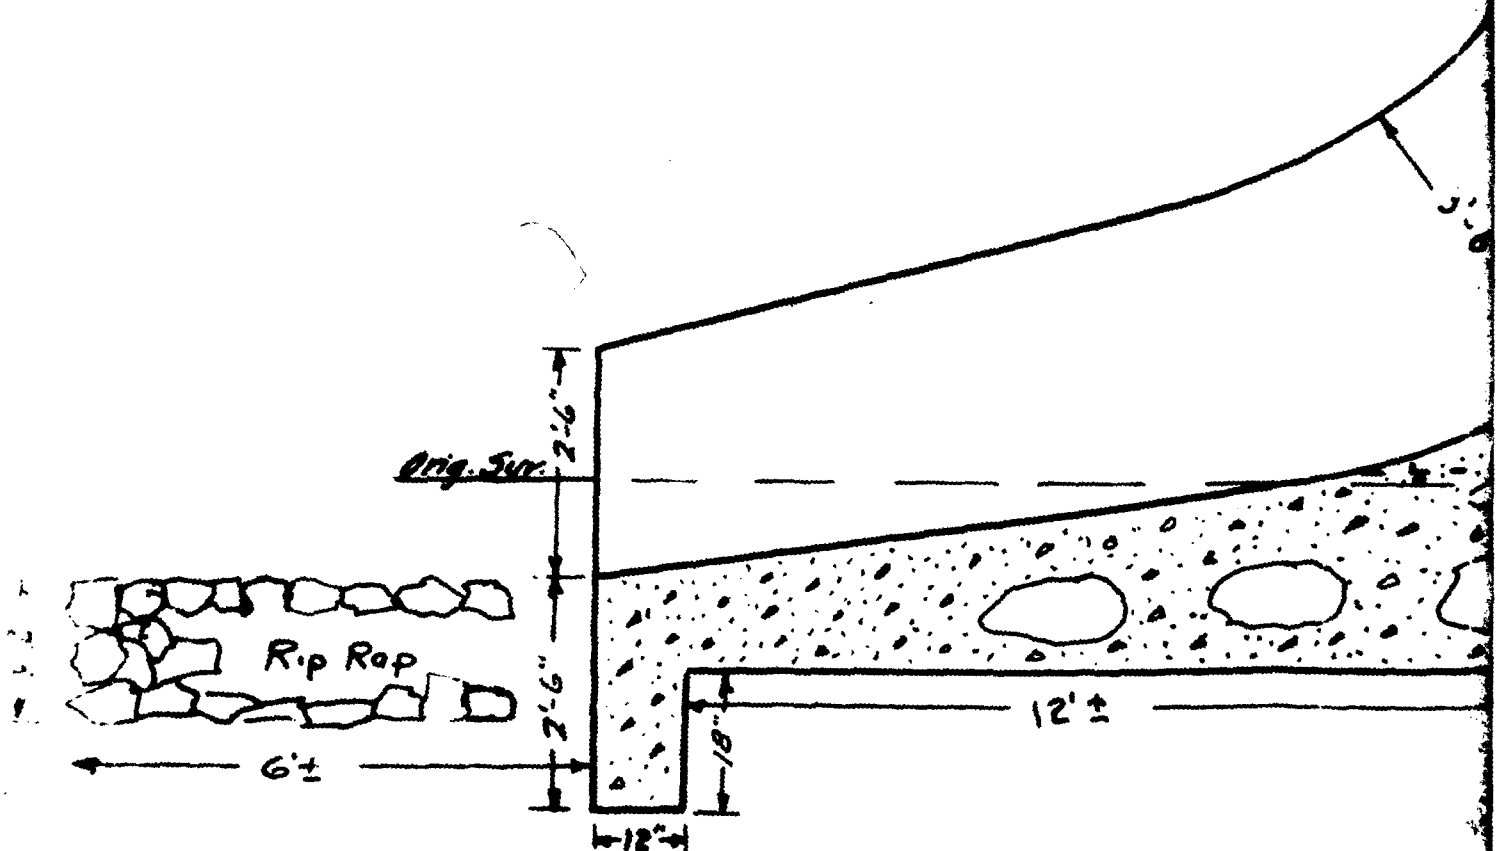

Existing rock dam
timber upstream
Built about 184

Present blowoff through 39
Proposed blowoff largest ph
through hole in dam, not 10


SECTION AT SP

Scale 1" = 2'

dam with
face
1840.

square hole in loose rock
st pipe which can be pushed
not less than 12"

SPILLWAY
2'

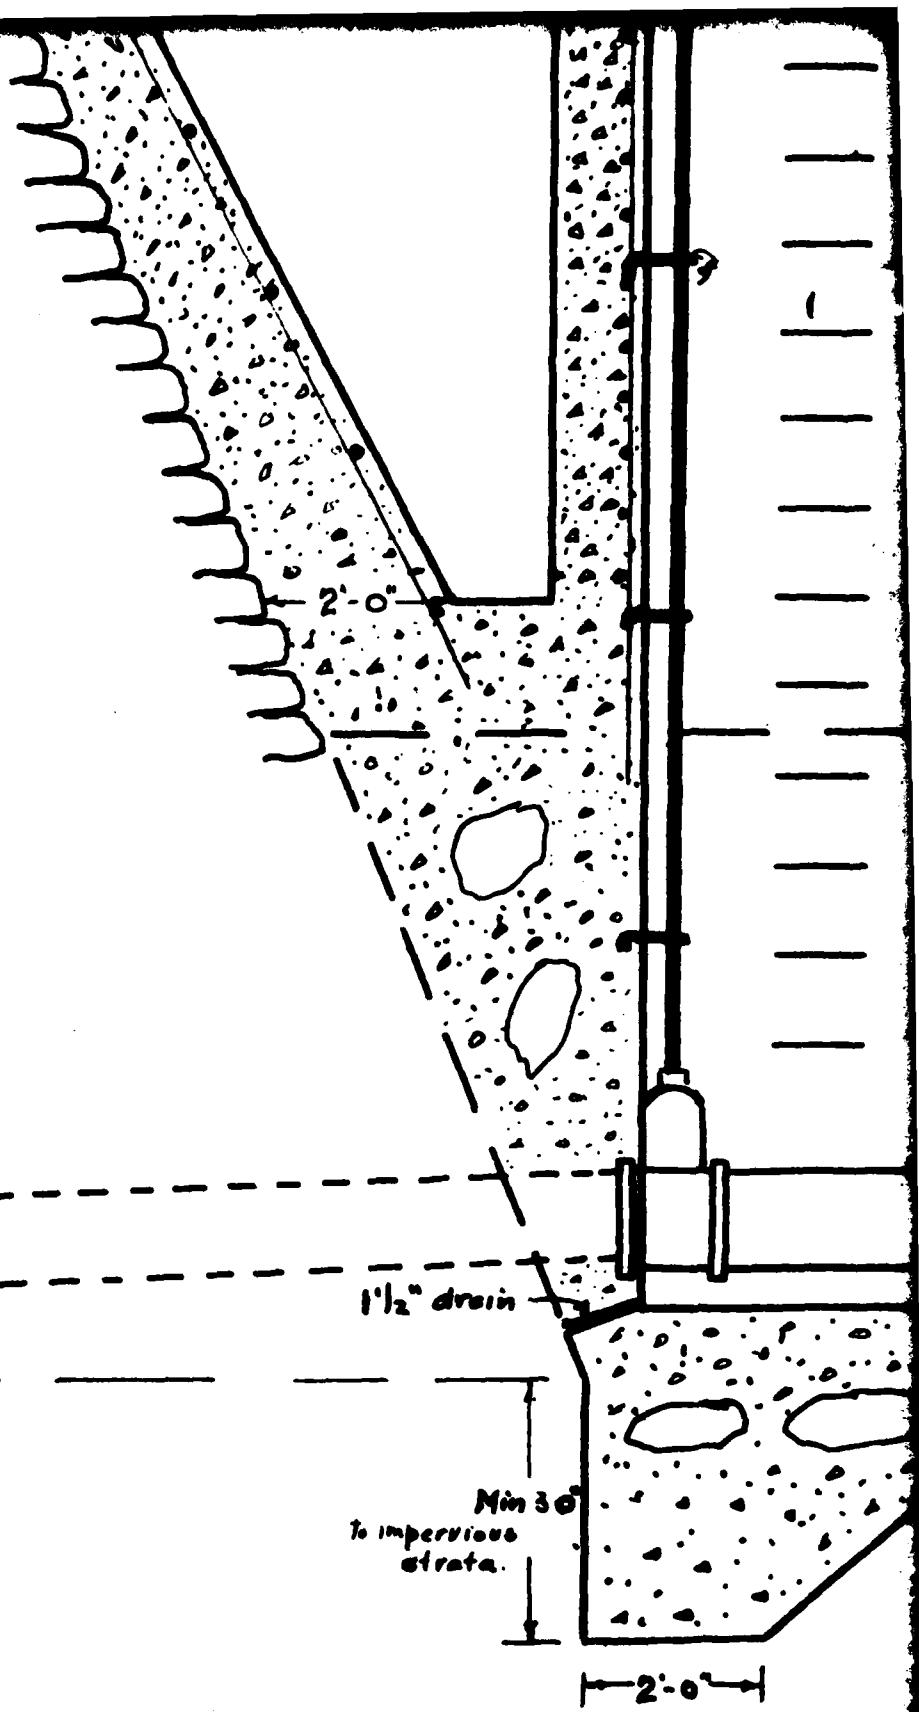

Approved by Board of Water Comm
of the Village of Cold Spring Feb

President

Clerk

Bottom of
Pond

Revised April 3, 1934 to show reinforcement
upstream concrete facing and valve chamber
Revised April 19, 1934 reinforcing " "

Brass Screen.

Elev. of intake to be
determined in field.

VILLAGE OF COLD SPRING
BOARD OF WATER COMMISSION
PROPOSED RECONSTRUCTION
LOWER FOUNDRY DAM
PHILIPSTOWN PUTNAM
SCALE - AS SHOWN JAN. 3

Approved by Board of Water Commissioners
of the Village of Cold Spring Feb. 1934.

President

Clerk

Revised April 9, 1934 to show reinforcement of
upstream concrete facing and valve chamber walls.
Revised April 19, 1934 reinforcing " " "

Screen.

of intake to be
mined in field.

**VILLAGE OF COLD SPRING
BOARD OF WATER COMMISSIONERS
PROPOSED RECONSTRUCTION
LOWER FOUNDRY DAM
MILLIPSTOWN PUTNAM CO., N.Y.
AS SHOWN JAN. 31, 1934.**

